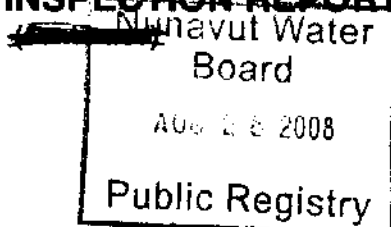




WATER USE INSPECTION REPORT

A = Acceptable
U = Unacceptable
N/A = Not Applicable
N/I = Not Inspected

Date: 13 Aug 2008



Licence #: 2BE-RA 0710
(Hayes Camp)

General Comments: ~~Continued~~

Licensor: Committee Bay Resources Ltd Company Rep: Alan Vosburgh (Logistics Mgr)

* Sites covered under license: Hayes, Ingot, Inuk, Bullion, Pore

* Camp sites active this season: Hayes and Bullion (8 days only)

* Potable Source: Sandspit Lake (downhill from camp; portable pump used to transfer water into storage tanks (x3 - 250 gallons each). (A)

* No flow measuring device (at camp or on drill) and no water treatment system used; water tested once per year by Consultant (U)

* Lack of signage (U)

Waste Disposal

* PACTO toilets used (waste is incinerated)

* Grey water sumps (from kitchen and Dry) into 3 pit areas; highly susceptible to erosion and seepage (U) licensee is to provide reinforcement and better form of retention. ^{1 used for overflow}

* Food and other burnable wastes are incinerated; ashes and non-combustible wastes are flown out to Ragan Inlet; hazardous waste, waste oil and contaminated fuel will remain on site until next year → licensee is to provide appropriate secondary containment and securing measures before camp is abandoned for the season. (A)

Fuel Storage

* Good use of insta berms around fuel heating drums (A) and camp refuelling/transfer areas. Standing water in some berms (U)

(U) * Lack of secondary containment at ~~fuel~~ main fuel drum caching area.

* Empty drums stored close to small pond (berm or liner should be placed underneath).

(A) Drilling lay down area is in good condition; area is susceptible to constant traffic and erosion control matting (or some other device/technique) is recommended.

M Joy MELISSA Joy
Water Inspector



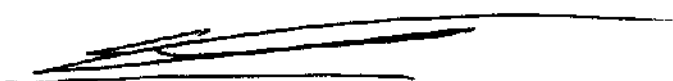
WATER USE INSPECTION REPORT (continued)

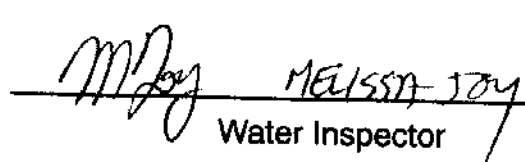
Date: 13 Aug 08

Licence #: Q BE-CR-0710
(Hayco Camp)

General Comments: (Continued)

- Good use of erosion control fencing at bottom of "gully" (A)
- Monitoring Program (or lack of) (U)
- (A) Land use permits and copy of water license on site (A)
- (U) Fuel Spill Contingency Plan is NOT current and is missing camp(s) specific information (dated Sept 2006); lack of updated contact info; lack of awareness (and proof) of following procedures (in terms of response, training and reporting) as stated/provided in company's own Spill Plan. (U)
- Licensee is reminded that plans, updates and reporting (as per the Annual Report) are to be site specific for each camp listed under the water license.
- ~~Licensee MD~~
- INSPECTOR'S DIRECTION: Licensee is hereby directed to address issues identified and listed by the Inspector before camp(s) is/are allowed to reopen next season. Licensee is provided 90 days to provide a plan pertaining to the above; to be instituted ^{upon} ~~beginning~~ camp reopening, upon meeting the approval of the Inspector.
- Licensee is also to provide a copy of camp shut-down procedures (and photographs) to the Inspector after camp is closed for the season.


Alan Vosburgh


Water Inspector