

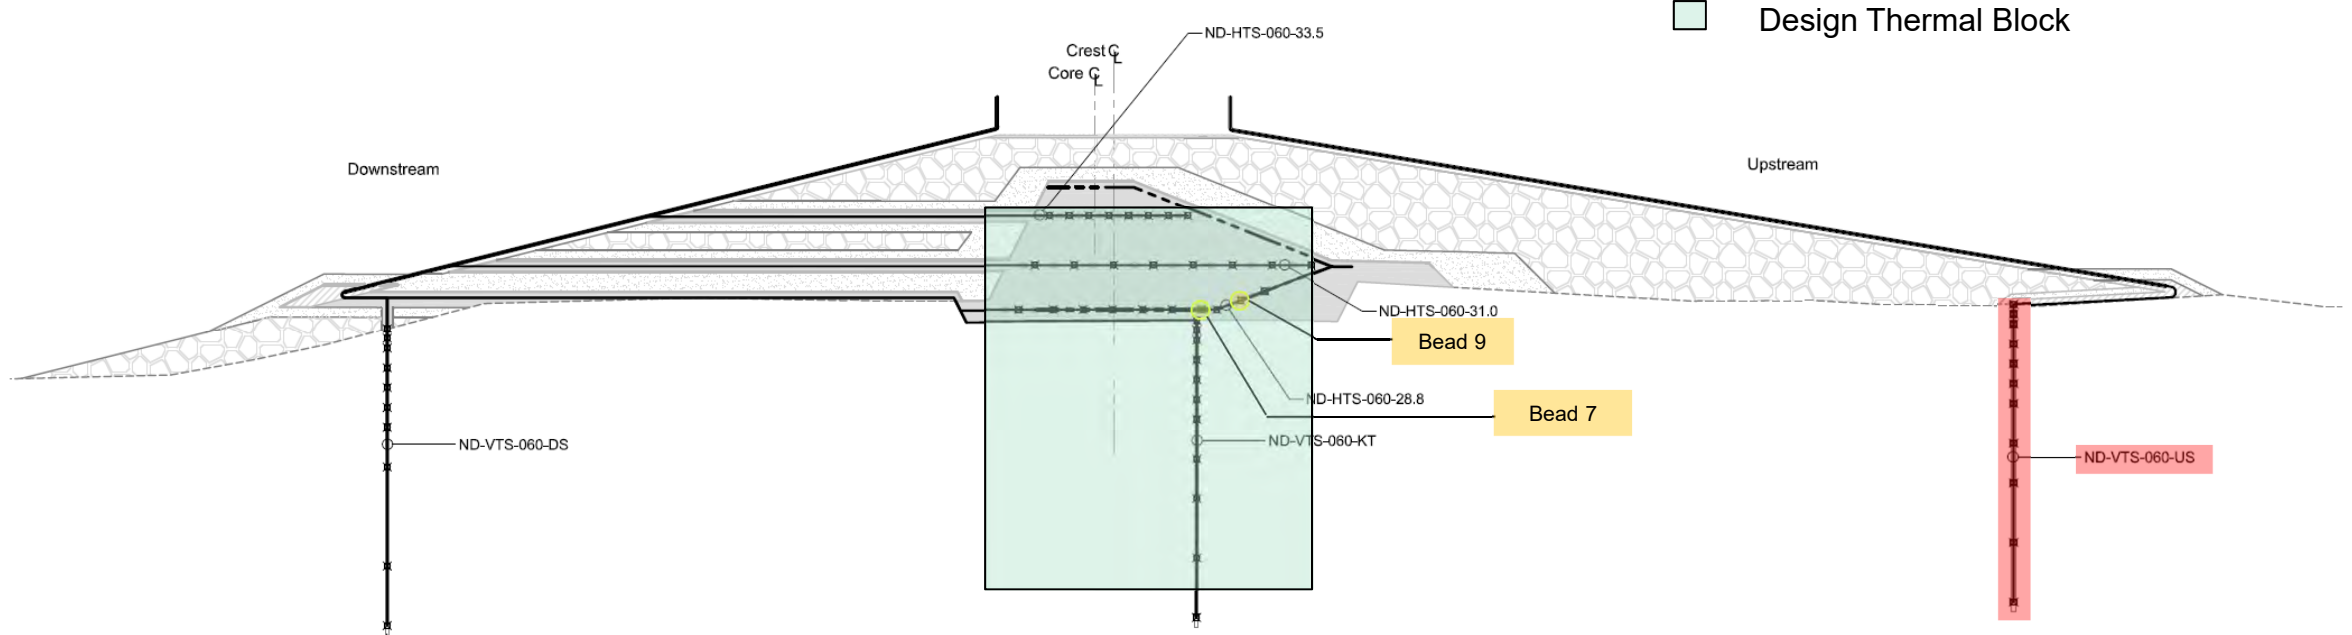
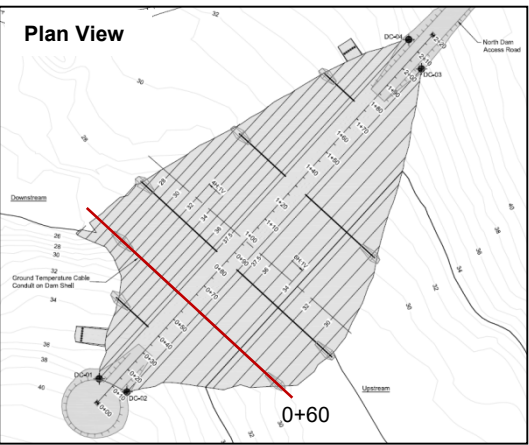
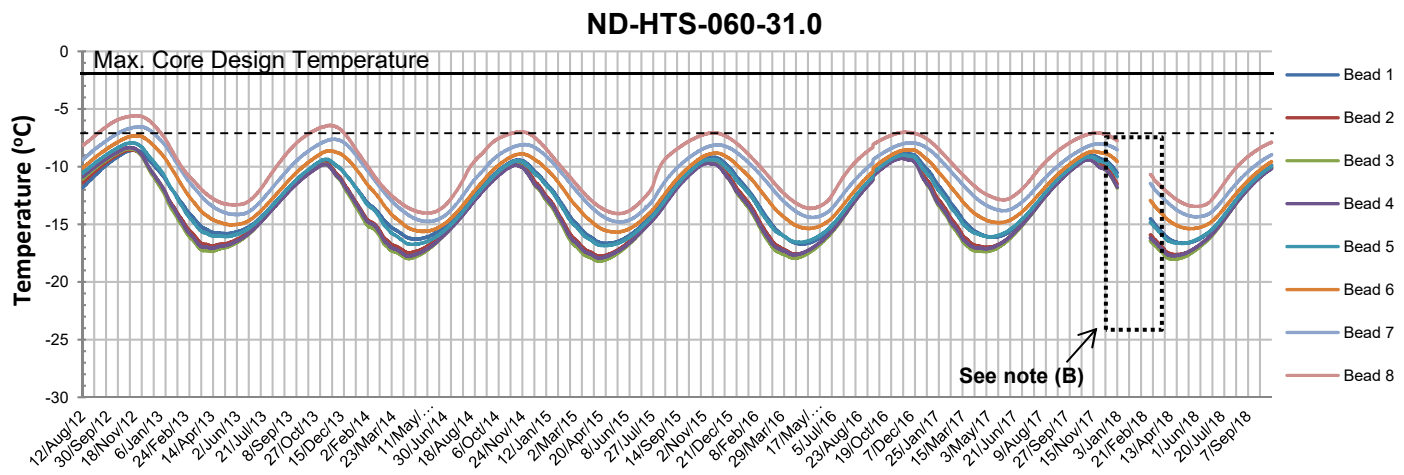


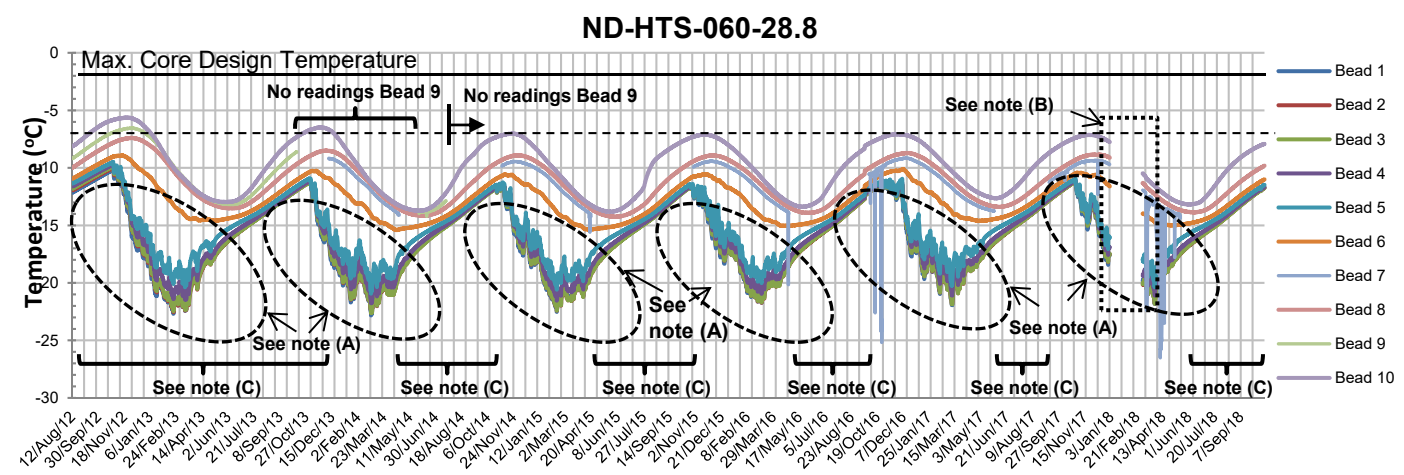

Legend:

- GTC Status: Cable irreparably damaged
- GTC Status: Bead damaged or data missing
- Design Thermal Block

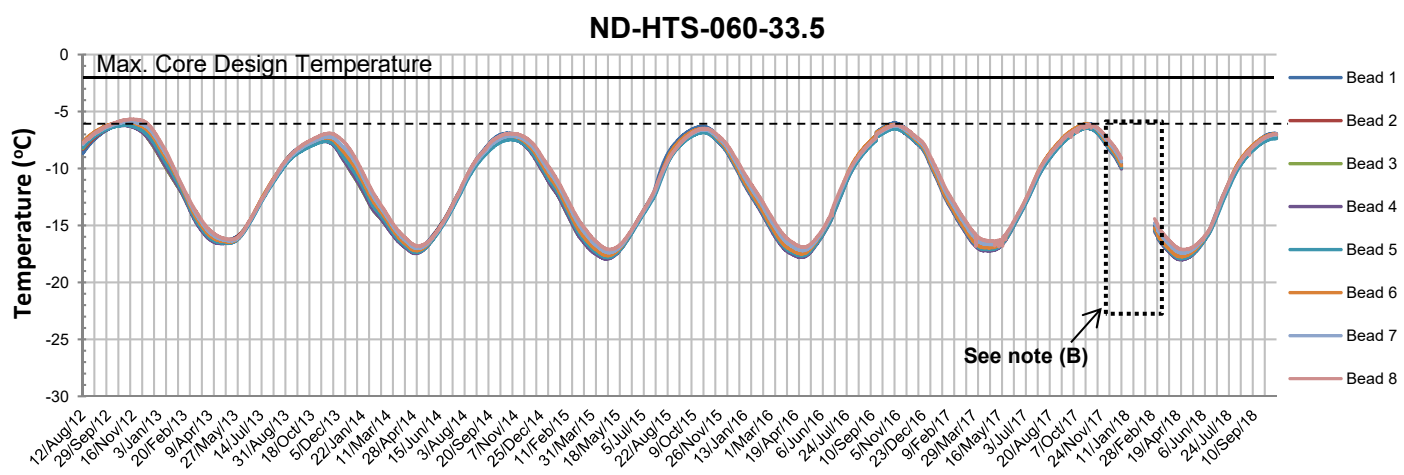








- Notes:**
- Bead numbers increase from downstream to upstream (horizontal) and top to bottom (vertical)
 - **(A)** Variation in Ground Temperature Cable readings during winter months due to close proximity of Ground Temperature Cable beads to thermosyphon pipes.
 - **(B)** Data logger was disconnected from January 1, 2018 to March 3, 2018 for recalibration
 - **(C)** No readings from Bead 7



Job No: 1CT022.028
Filename: AppB_1CT022.028_ND_GTC

DORIS TIA

2018 Annual Geotechnical Inspection		
Station 0+60 Horizontal Ground Temperature Cable Temperature Vs. Time		
Date: Jan. 2019	Approved: PL	Figure: B.3

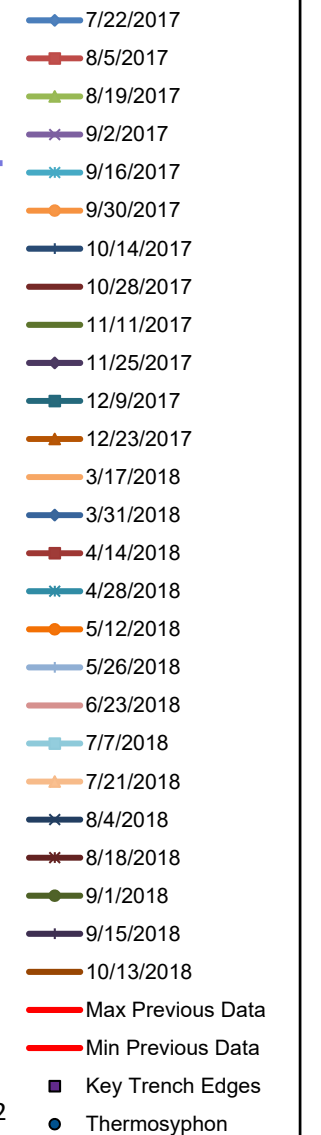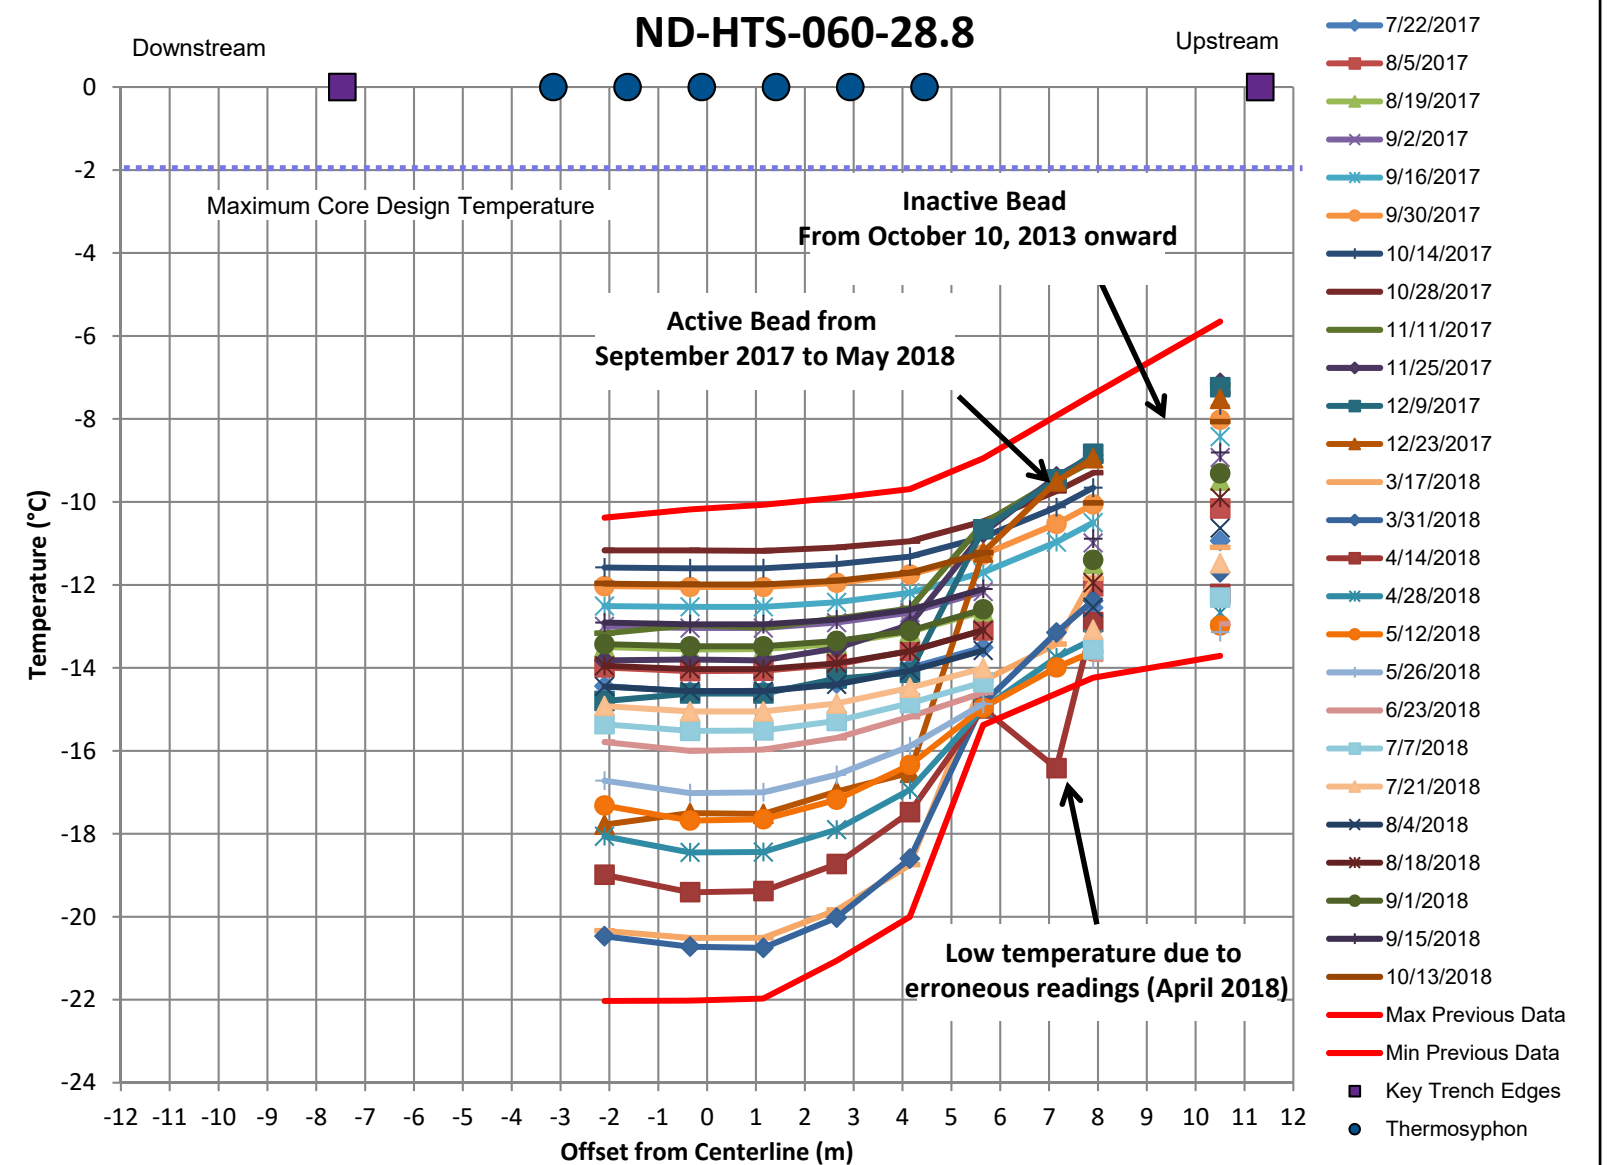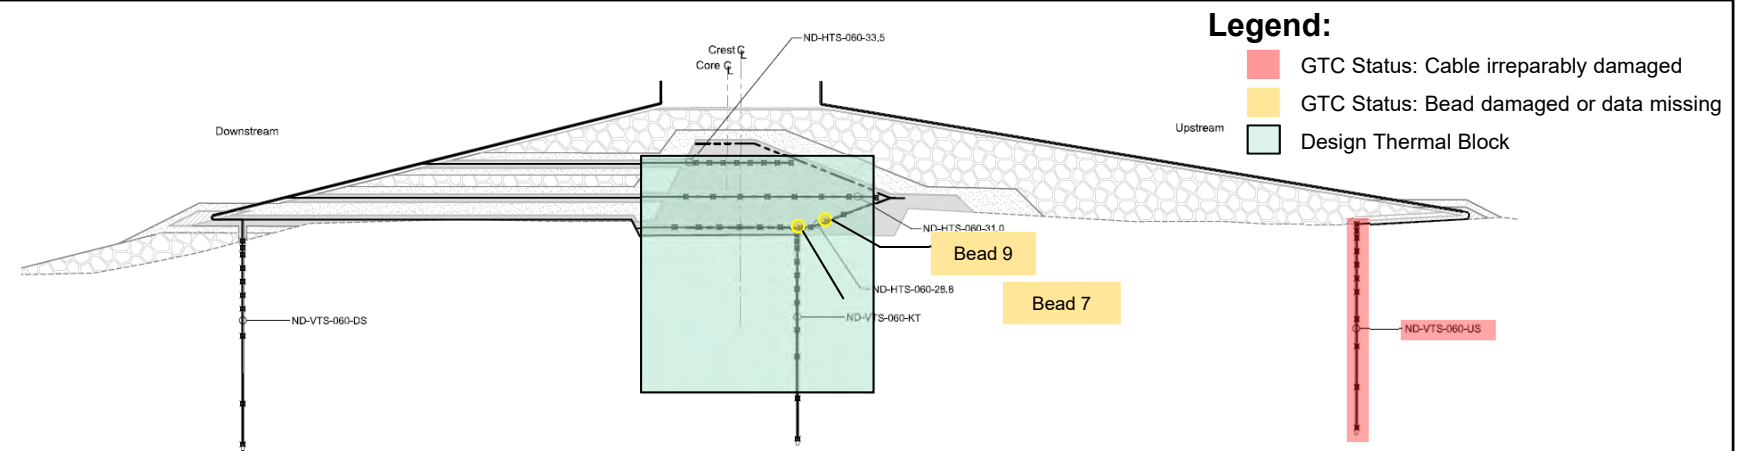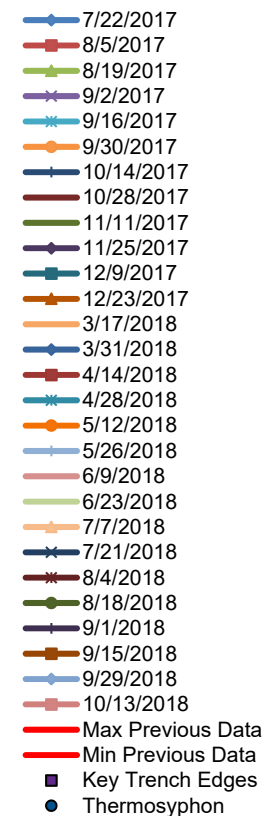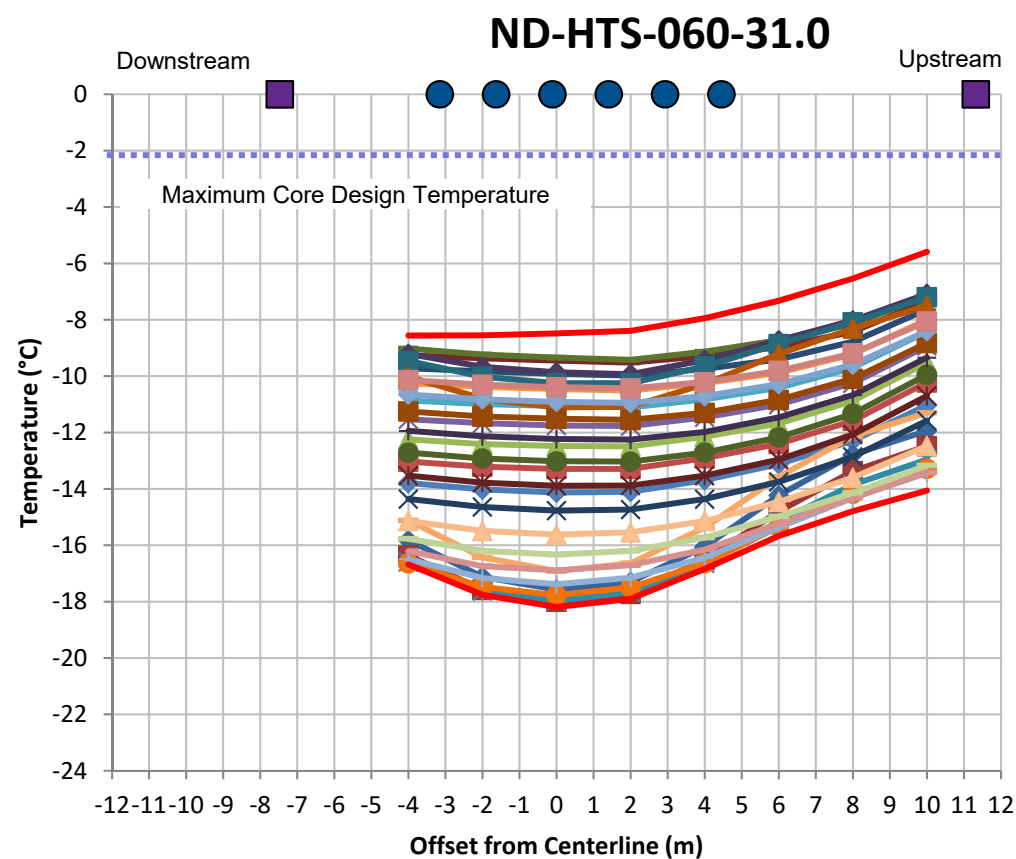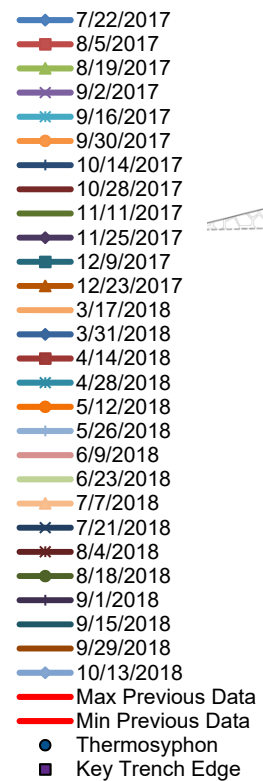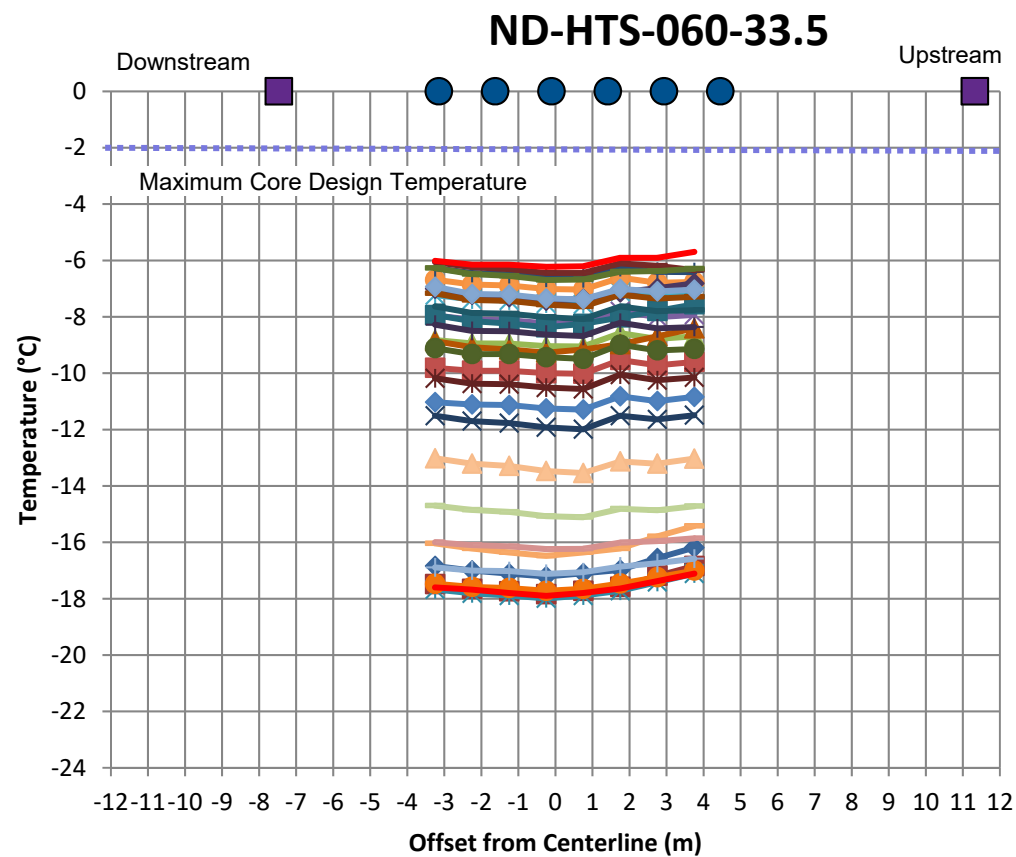

Note:

- Previous Data was recorded between August 2012 and July 2017
- Data logger was disconnected from January 1, 2018 to March 3, 2018 for recalibration



Job No: 1CT022.028
Filename: AppB_1CT022.028_ND_GTC



DORIS TIA

2018 Annual Geotechnical Inspection

Station 0+60
Horizontal Ground Temperature
Cable Readings by Location

Date: Jan. 2019
Approved: PL
Figure: B.4