

[illegible]



[illegible]




## ACKNOWLEDGMENTS

The project was supported by Indian and Northern Affairs Canada through its office in Iqaluit, Nunavut. We would like to thank Lou Spagnuolo for making the project run so smoothly this year.

The work was conducted in conjunction with the Qikiqtaaluk Corporation. Thanks are due to the many QC personnel who helped us with our work.

Allison Rutter and John Poland, Queen's University directed the project. They were ably assisted by on site team leaders Kevin McKenna, Indra Kalinovich, Krysta Paudyn and Nathan Manion and Chris McWatters, Sarah Jeswiet, Jared MacKay, Paleah Black, David Whitmore and Tina Decouto. Maps were done by Graham Cairns. This report was written by John Poland with contributions from Indra Kalinovich and Krysta Paudyn and edited by Allison Rutter.

Some laboratory analyses were conducted by Queen's University Analytical Services Unit, Kingston, Ontario. Thanks are due to Paula Whitley, Mary Andrews, Michele Pacey, Melanie Wright and Kalam Mir, in addition to those listed above, who provided their usual high professional standards.

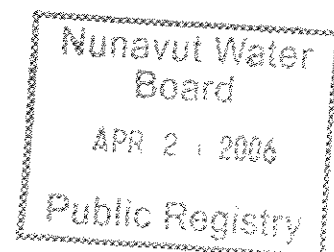



## TABLE OF CONTENTS

<b>I. OVERVIEW.....</b>	<b>I-1</b>
A. GENERAL .....	I-1
B. SITE ACTIVITIES.....	I-2
C. ON SITE SCIENTIFIC INVESTIGATIONS .....	I-4
D. LONG TERM MONITORING PLAN.....	I-7
1. <i>Landfills</i> .....	I-7
2. <i>PCB Barriers</i> .....	I-8
3. <i>Landfarms and TPH Barrier System</i> .....	I-8
4. <i>Background PCB in Plants</i> .....	I-8
5. <i>Monitoring Frequency</i> .....	I-9
6. <i>Infrastructure and Logistics</i> .....	I-9
a) Transportation to the Site.....	I-10
b) Barrier Sediment .....	I-10
c) Ground Transportation and Equipment .....	I-11
d) Personnel.....	I-11
E. OTHER ACTIVITIES.....	I-12
<b>II. REMEDIATION.....</b>	<b>II-1</b>
A. GENERAL .....	II-1
B. METHODOLOGY .....	II-1
1. <i>Excavation</i> .....	II-1
a) CEPA Soils .....	II-1
b) Tier II Soils .....	II-2
c) Tier I soils .....	II-2
2. <i>Sampling</i> .....	II-3
3. <i>Mapping</i> .....	II-3
4. <i>PCB Analysis</i> .....	II-4
a) Laboratory Analyses (GC/ECD) (Soil Samples) .....	II-4
b) Laboratory Analyses (GC/ECD) (Other Matrices) .....	II-5
5. <i>Metal Determinations</i> .....	II-6
a) Copper, Lead and Zinc by XRF .....	II-6
b) Metals by ICP/AES.....	II-6
C. S1/S4 BEACH AREA.....	II-7
1. <i>Background</i> .....	II-7

2. Soil Excavation .....	II-7
D. S1/S4 BUILDINGS AND VALLEY AREA.....	II-19
1. Background.....	II-19
2. Soil Excavation .....	II-19
E. PCL DUMP .....	II-29
1. Background.....	II-29
2. Soil Excavation .....	II-29
F. NORTH SLOPE DUMP.....	II-33
1. Background.....	II-33
2. Soil Excavation .....	II-33
G. DND HELIPAD.....	II-35
1. Background.....	II-35
2. Soil Excavation .....	II-35
H. MAINTENANCE DUMP .....	II-37
1. Background.....	II-37
2. Soil Excavation .....	II-37
I. BEACH DUMP.....	II-39
1. Background.....	II-39
2. Soil Excavation .....	II-39
<b>III. SITE INVESTIGATIONS .....</b>	<b>III-1</b>
A. GENERAL .....	III-1
B. TIER II LANDFILL.....	III-1
C. TIER II LANDFILL MONITORING PROGRAM.....	III-7
1. Monitoring Wells .....	III-7
2. Soil Samples.....	III-12
3. Discussion of Analytical Results.....	III-14
a) Metals.....	III-14
b) PCBs .....	III-16
c) TPH.....	III-17
D. AIRSTRIP LANDFILL MONITORING PROGRAM .....	III-18
E. MAINTENANCE DUMP MONITORING PROGRAM .....	III-21
F. BARRELS AND THEIR CONTENTS.....	III-24
G. AIR SAMPLING FOR PCBs AND CHLOROBENZENES.....	III-29
H. DRINKING WATER .....	III-32
1. Analysis.....	III-32



2.	<i>Methods</i> .....	III-32
3.	<i>Drinking Water</i> .....	III-32
I.	LAKE WATER.....	III-35
J.	BACKGROUND WATER SAMPLES .....	III-36
K.	BACKGROUND PLANT SAMPLES.....	III-40
1.	<i>Analytical Method</i> .....	III-40
2.	<i>Plant Analysis Results</i> .....	III-40
L.	MISCELLANEOUS ACTIVITIES.....	III-43
M.	QUALITY CONTROL DATA .....	III-46
1.	<i>PCB Quality Control/Quality Assurance</i> .....	III-46
2.	<i>TPH Quality Control/Quality Assurance</i> .....	III-47
<b>IV.</b>	<b>PCB Storage</b> .....	<b>IV-1</b>
1.	<i>CEPA Soil</i> .....	IV-1
2.	<i>Beach PCB Storage Facility</i> .....	IV-2
<b>V.</b>	<b>Fuel Contamination</b> .....	<b>V-1</b>
A.	GENERAL .....	V-1
B.	REMEDICATION CRITERIA .....	V-2
C.	ANALYTICAL METHODS.....	V-3
1.	<i>Sampling</i> .....	V-3
2.	<i>Total TPH Analysis</i> .....	V-3
3.	<i>CCME TPH Analysis</i> .....	V-4
4.	<i>Identification</i> .....	V-5
5.	<i>Microbial Analysis</i> .....	V-5
6.	<i>C<sub>17</sub>/Pristane and C<sub>18</sub>/Phytane Ratios</i> .....	V-6
D.	BARREL CACHE VALLEY .....	V-7
E.	IMPLODED TANK AREA.....	V-8
1.	<i>Ponding and Barrier Research</i> .....	V-9
F.	BEACH POL AREA.....	V-16
G.	LANDFARMING.....	V-18
1.	<i>General</i> .....	V-18
2.	<i>Trial Plots Constructed in 2003</i> .....	V-19
3.	<i>Main Landfarm</i> .....	V-26
4.	<i>In Situ Landfarm</i> .....	V-34
H.	LABORATORY LANDFARM STUDY .....	V-38

1. First Set of Reactors.....	V-38
2. Second Set of Reactors Experiments.....	V-44
a) GAC Traps.....	V-45
b) Soil TPH Levels.....	V-48
c) General Conclusions.....	V-50
I. RATE CONSTANT CALCULATIONS AND CONCLUSIONS.....	V-53
1. Aeration.....	V-57
2. Bioremediation.....	V-57
3. General Conclusions.....	V-58
<b>VI. BARRIER RESEARCH.....</b>	<b>VI-1</b>
A. BACKGROUND.....	VI-1
B. S1/S4 VALLEY BARRIER.....	VI-2
1. Introduction.....	VI-2
2. 2005 Field Work.....	VI-4
3. Monitoring.....	VI-8
a) Water.....	VI-8
b) Sediment.....	VI-8
c) Filters.....	VI-9
C. S1/S4 BEACH BARRIER.....	VI-12
1. General.....	VI-12
2. Design and Construction.....	VI-12
3. Monitoring.....	VI-19
D. FURNITURE DUMP BARRIER.....	VI-20
1. General.....	VI-20
2. 2005 Barrier Modifications.....	VI-21
3. Monitoring.....	VI-23
a) Water.....	VI-23
b) Sediment.....	VI-23
c) Filters.....	VI-23
d) metals.....	VI-25
E. LABORATORY STUDIES.....	VI-26
1. Batch tests.....	VI-27
2. Column Tests.....	VI-29
F. SUMMARY AND CONCLUSIONS.....	VI-33
<b>VII. Appendix.....</b>	<b>VII-1</b>

## LIST OF PHOTOGRAPHS

Photograph II-1: The 1994 Barrier Still in Place at the Start of the Season .....	II-11
Photograph II-2: The Same Area After PCB Excavation .....	II-11
Photograph II-3: Excavating Tier II Contaminated Soils at the S1/S4 Beach Area. The Green Areas May Still Contain CEPA Soils and the Top of the Disturbed Areas Tier II Soils. Both Were Too Dangerous to Excavate .....	II-12
Photograph II-4: Heavy Equipment Working at the S1/S4 Beach Area.....	II-12
Photograph II-5: Establishing the Grid in Between Excavating Tier II and Tier I Soils..	II-13
Photograph II-6: Excavating Tier II Soils From a Platform Close to the Cliff.....	II-13
Photograph II-7: The S1/S4 Beach Area After Excavation .....	II-14
Photograph II-8: The Clay Stratum Beneath the Tier II and Tier I Excavated Area ....	II-14
Photograph II-9: Removing the Last of the CEPA Soil by Hand From a Pocket of High Contamination Found Below Dish B.....	II-23
Photograph II-10: Using the Vacuum Truck to Remove the CEPA Soil From Near Building S4 .....	II-23
Photograph II-11: Placing Stockpiled Tier II Soil Into Trucks That Transported It to the Tier II Landfill .....	II-24
Photograph II-12: Dave Lorenzon Heavy Equipment Operator Extraordinaire.....	II-24
Photograph II-13: The End of the S1/S4 Valley After Removal of all Tier II and Tier I PCB Contaminated Soil: The Barrier Is Just Visible in the Background .....	II-25
Photograph II-14: Most of the S1/S4 Buildings Area was Scraped to Bedrock in Removing Tier II and Tier I Soils.....	II-25
Photograph II-15: Debris in the PCL Dump From the Polevault Station Operation and More Recent Activities .....	II-30
Photograph II-16: Excavating the Debris From the PCL Dump.....	II-31
Photograph II-17: The Drainage Pathway of the PCL Dump Was Long and Narrow With Little Soil That Could be Excavated.....	II-31
Photograph II-18: Debris in the North Slope Dump Was Scraped to the Toe of the Dump After the Contaminated Soil Was Excavated and Removed .....	II-34

Photograph II-19: Excavating the PCB Contaminated Soil at the DND Helipad Site .	II-36
Photograph II-20: The Maintenance Dump Drainage Pathway Roped Off For Excavation .....	II-38
Photograph II-21: Excavating Metal Contaminated Soils at the Beach Dump .....	II-41
Photograph II-22: Two Large Old Pieces of Equipment Were All that Remained at the Main Beach Dump After Contaminated Soil Was Excavated to Bedrock .....	II-41
Photograph III-1: Soil was Transported From the Various Tier II Contaminated Areas and Placed Within the Lined Area of the Tier II Landfill .....	III-3
Photograph III-2: Soil Was Placed in Lifts in the landfill and Compacted: Metal Contaminated Soils Previously Stored in Wooden Boxes Were Placed in the Landfill	
Photograph III-3: Contaminated Soil was Added to the Landfill in Lifts and Compacted .....	III-3
Photograph III-3: Contaminated Soil was Added to the Landfill in Lifts and Compacted .....	III-4
Photograph III-4: Constructing the Landfill in Foggy Conditions .....	III-4
Photograph III-5: The Top Liner was Added When All Contaminated Soil Was in Place .....	III-5
Photograph III-6: Finally a Cap of Clean Gravel Was Added to Ensure Freeze Back of All the Contaminated Material Within the Landfill.....	III-5
Photograph III-7: Torrential Rains Caused Flooding of the Landfill During Construction: The Water was Pumped Out and Discharged Through the PCB Barrier.....	III-6
Photograph III-8: Thermister Strings Were Installed as Part of the Long Term Monitoring Program.....	III-6
Photograph III-9: Tina Decouto and Sara Jeswiet Collecting Water From Monitoring Well Number 4 at the Tier II Landfill.....	III-8
Photograph III-10: Collecting Soil at the Soil Monitoring Point Next to Well 13 at the Airstrip Landfill: The Soil Monitoring Point is Marked by the Orange Stakes...	III-19
Photograph III-11: Collecting Water at the Maintenance Dump Newly Installed Monitoring Well After Purging .....	III-22
Photograph III-12: David Whitmore and Jared McKay Taking a Sample From a Barrel Containing a Liquid of Unknown Composition.....	III-28

Photograph III-13: Taking Barrel Samples From Behind the Old Officer's Mess.....	III-28
Photograph III-14: Collecting a Background Water Sample From the Maintenance Dump Drainage Channel Prior to its Excavation.....	III-39
Photograph III-15: The Pond Below the Cliff from the Old Water Lake and the Stream to the Sea That is Crossed by the Road to the S1/S4 Beach Area: Background Water Samples Were Collected from the Stream and the Pond .....	III-39
Photograph III-16: Sampling the Concrete Floor of Building B2 Which Previously Had Contained PCB Contaminated Soils and PCB Containing Transformers .....	III-43
Photograph V-1: The Remains of the Imploded Tank After its Demolition: Note the Hydrocarbon Contaminated Pad and the Main Landfarm Beyond.....	V-8
Photograph V-2: The Drainage Pathway From the Imploded Tank and Main Landfarm With the Pond and Barrier System at the Start of the 2005 Season.....	V-10
Photograph V-3: Sampling the Water at the Barrier Pond in late June 2005 .....	V-15
Photograph V-4: Sampling the GAC Filter at Three Depths.....	V-15
Photograph V-5: Rototilling the Experimental Landfarm Plots .....	V-25
Photograph V-6: Measuring the Temperature of the Soil in the Experimental Landfarm .....	V-25
Photograph V-7: Digging a Pit in Order to Collect a Soil Sample From the Grid Set Out on the Main Landfarm .....	V-32
Photograph V-8: Attempting to Use an ATV and Harrow to Till the Main Landfarm	V-32
Photograph V-9: Aerating the Main Landfarm With the IT24 Loader.....	V-33
Photograph V-10: Aerating the Main Landfarm.....	V-33
Photograph V-11: Excavating Plots For the In Situ Landfarm Experiment.....	V-36
Photograph V-12: Tamping Down the Soil in the In Situ Landfarm Plots.....	V-36
Photograph V-13: Some of the Reactors in the Cold Room at 8 °C.....	V-40
Photograph VI-1: The S1/S4 Valley Barrier at the Start of the 2005 Season.....	VI-6
Photograph VI-2: A Large Volume of Sediment Was Collected by the Funnel and Gate System. Water Was Still Flowing Through the Filter Box.....	VI-6
Photograph VI-3: Excavating the Sediment Trapped in the S1/S4 Valley Barrier.....	VI-7

Photograph VI-4: Removing the Very Wet Sediment From the Main Trap in Front of the Filter Box .....	VI-7
Photograph VI-5: The S1/S4 Beach Barrier Next to the Sea Constructed in 1994 Prior to Excavation of the PCB Contaminated Soil .....	VI-14
Photograph VI-6: After All the PCB Contaminated Soil had been Removed from the S1/S4 Beach Area, a Drainage Channel was Excavated and Contoured.....	VI-14
Photograph VI-7: The Ground was then Prepared for Attachment of the Filter Box at the End of the Channel Just Above the Four Meter Drop to the Sea.....	VI-15
Photograph VI-8: Access to the Base of the New Barrier was Via a Steep Track .....	VI-15
Photograph VI-9: Gabion Walls Were Constructed to Form the Channel Through Which Water From the S1/S4 Beach Area Then Was Forced to Flow .....	VI-16
Photograph VI-10: After the Geocomposite Clay Liner was Placed in Position, It was Wetted to Form a Sealed Channel .....	VI-16
Photograph VI-11: A Black Liner Was Then Placed on Top of the GCL and Sealed Around the Filter Box. Sandbags Secured the Liner to the Contoured Channel	VI-17
Photograph VI-12: Gabions Were Placed Across the Drainage Channel Above the Steep Slope Leading to the Barrier as an Additional Sediment Trap .....	VI-17
Photograph VI-13: The Channel Above the Top Gabion Sediment Trap Was Lined With Cobbles To Trap More Sediment.....	VI-18
Photograph VI-14: The S1/S4 Beach Barrier Nearing Completion.....	VI-18
Photograph VI-15: After Removing the Wooden Filter Box, a Concrete Base was Poured and Rock Bolts were Positioned to Secure the Stainless Steel Base Plate in Place.	VI-22
Photograph VI-16: A New Stainless Steel Filter Box was then Placed Over the Lined Catchment Zone in the Furniture Dump Drainage Pathway.....	VI-22
Photograph VI-17: The New Stainless Steel Column.....	VI-34
Photograph VI-18: The Column Apparatus With The New Stainless Steel Column.	VI-34

## LIST OF TABLES

Table II-1: PCB Concentrations in Soil Samples Collected During Excavation at the S1/S4 Beach Area .....	II-15
Table II-2: PCB Concentrations in Soil Samples Collected During Excavation at the S1/S4 Buildings and Valley Areas.....	II-26
Table II-3: PCB Concentrations in Soil Samples Collected Prior to Excavation at the PCL Dump.....	II-32
Table II-4: PCB Concentrations in Soil Samples Collected Prior to Excavation at the North Slope Dump .....	II-33
Table II-5: PCB Concentrations in Additional Delineation Soil Samples at the DND Helipad Area .....	II-35
Table II-6: Cobalt Concentrations in Soil Samples Collected After Excavation at the Maintenance Dump.....	II-37
Table II-7: PCB and Metal Concentrations in Soil Samples Collected Prior to Excavation at the Beach Dump.....	II-42
Table II-8: PCB and Metal Concentrations in Soil Samples Collected During Excavation at the Beach Dump.....	II-43
Table III-1 Contents of the Tier II Landfill .....	III-2
Table III-2: Results of Analyses for Metals, PCBs and TPH of Samples Taken From the Borrow Source of Material for the Landfill Construction .....	III-2
Table III-3A: Results of Analyses of Water Samples Taken From MW 1A.....	III-9
Table III-3B: Results of Analyses of Water Samples Taken From MW-2.....	III-9
Table III-3C: Results of Analyses of Water Samples Taken From MW-3A.....	III-10
Table III-3D: Results of Analyses of Water Samples Taken From MW-4 .....	III-10
Table III-3E: Results of Analyses of Water Samples Taken From MW-5A.....	III-11
Table III-3F: Results of Analyses of Water Samples Taken From MW-5B .....	III-11
Table III-3G: Results of Analyses of Water Samples Taken From MW-6 .....	III-12

Table III-4 : Results of Analyses of Soil Samples Taken From Close to the Monitoring Wells at the Tier II Landfill Site .....	III-13
Table III-5: Summary of Elemental Levels at the 28 Soil Samples Collected From the Tier II Landfill Soil Monitoring Points in 2004 and 2005 (ppm) .....	III-14
Table III-6: Summary of Elemental Levels in the 86 Water Samples Collected From the Tier II Landfill Monitoring Wells in 2004 and 2005 (ppm) .....	III-15
Table III-7: Results of Analyses of Water Samples Taken From the Monitoring Wells at the Airstrip Landfill .....	III-20
Table III-8: Results of Analyses of Soil Samples Taken From Close to the Monitoring Wells at the Airstrip Landfill .....	III-20
Table III-9: Results of Analyses of Water Samples Taken From the Monitoring Wells at the Maintenance Dump .....	III-23
Table III-10: Results of Analyses of Soil Samples Taken From Close to the Monitoring Wells at the Maintenance Dump .....	III-23
Table III-11: Description of Barrels and Description and Identity of Barrel Contents ..	III-25
Table III-12: PCB, Chlorine, and Metal Concentrations of Barrel Contents.....	III-26
Table III-13: PCB Concentrations in Air Samples Collected at Resolution Island....	III-30
Table III-14: Chlorobenzene Compounds Found in Air Samples Collected at Resolution Island (ug per tube plus filter).....	III-30
Table III-15: Chlorobenzene Concentrations in Air Samples Collected at Resolution Island (mg per m <sup>3</sup> ) .....	III-31
Table III-16: Drinking Water Results and Guidelines.....	III-32
Table III-17: Drinking Water pH Results .....	III-33
Table III-18: Lake Water Results .....	III-35
Table III-19: Summary of Analytical Results Obtained from Background Water Samples Over the Period 2001 – 2004 .....	III-37
Table III-20: Sampling Locations and Collection Dates of Background Water Samples .....	III-37
Table III-21: Analytical Results Obtained from Background Water Samples .....	III-38



Table III-22: Results of Analyses of Background Plant Samples.....	III-41
Table III-23: Results of Analyses for PCBs in Concrete Samples From the Floor of Building B2.....	III-43
Table III-24: Results of Analyses for PCBs in Material in Plastic Drums in the PCB Registered Storage Facility .....	III-44
Table III-25: PCB Concentrations in Blank and Spiked QA/QC Soil and Other Solid Samples.....	III-47
Table III-26: PCB Concentrations in Laboratory Duplicate Soil and Other Solid Analysis .....	III-48
Table III-27: PCB Concentrations in Field Duplicate Soil and Other Solid Analysis.	III-49
Table III-28: PCB Concentrations in Low Level Laboratory Duplicate Soil Analysis	III-50
Table III-29: PCB Concentrations in Blank and Spiked Low Level Soil Analyses ....	III-50
Table III-30: PCB Concentrations in Blank and Spiked QA/QC Water Samples.....	III-50
Table III-31: PCB Concentrations in Duplicate Water Samples .....	III-50
Table III-32: PCB Concentrations in Blank and Spiked QA/QC Plant Samples .....	III-51
Table III-33: TPH Concentrations in Blank and Spiked QA/QC Soil Samples .....	III-51
Table III-34: TPH (Fuel) Soil Concentrations in Laboratory Duplicate Analysis.....	III-51
Table III-35: TPH (Lubricating Oil and Grease) Soil Concentrations in Laboratory Duplicate Analysis.....	III-52
Table III-36: TPH (Fuel) Soil Concentrations in Field Duplicate Analysis .....	III-53
Table III-37: TPH (Lubricating Oil and Grease) Soil Concentrations in Field Duplicate Analysis.....	III-53
Table III-38: TPH Concentrations in Blank and Spiked QA/QC Water Samples.....	III-53
Table III-39: TPH Water Concentrations in Laboratory Duplicate Analysis .....	III-54
Table III-40: Metal Water Concentrations in Laboratory Blank Determinations.....	III-54
Table III-41: Metal Water Concentrations in QC Control Samples .....	III-55
Table III-42: Metal Water Concentrations in Laboratory Duplicate Analysis (ppb)...	III-55
Table III-43: Metal Soil Concentrations in Blank and Reference Material (ppm) .....	III-56

Table III-44: Metal Soil Concentrations in Laboratory Duplicate Analysis (ppm).....	III-56
Table III-45: Data for Barrel Blank and Quality Control Samples.....	III-57
Table III-46: Replicate Analysis Results for Barrel Contents .....	III-57
Table IV-1: List of the Contents of the Beach PCB Storage Facility All of Which Were Transported Off Site .....	IV-3
Table IV-2: List of the Individual Containers of CEPA Soil Transported to the Licenced Destruction Facility at St Amboise, Quebec.....	IV-14
Table V-1: CCME-TPH Tier 2 Derived Remediation Criteria for Arctic Soils .....	V-2
Table V-2: Results of Analyses of Delineation Samples for CCME-TPH at the Beach POL Area Obtained in 2003 (ppm).....	V-7
Table V-3: Results of Soil Analyses for TPH at the Imploded Tank Drainage Area Ponds and Barriers.....	V-12
Table V-4: Results of Water Analyses for TPH at the Imploded Tank Drainage Area Ponds and Barriers .....	V-12
Table V-5: Results of Sand/GAC Analyses for TPH at the Imploded Tank Drainage Area Ponds and Barriers .....	V-13
Table V-6: Soil Nitrogen and Phosphorus Levels (ppm) in the Drainage Pathway .....	V-14
Table V-7: Results of Analyses for TPH of the Soil at the Site of the Two Demolished Beach POL Tanks .....	V-16
Table V-8: Summary of Results of Analyses of Soil Samples for TPH from the Landfarm Plots in 2003, 2004 and 2005.....	V-20
Table V-9: Soil and Air Temperatures at the Field Trial Landfarm From 17 July to 6 September 2005 .....	V-23
Table V-10 Results of Analyses for Hydrocarbon Degradation at the Experimental Landfarm.....	V-24
Table V-11 Results of Analyses for CCME-TPH at the Experimental Landfarm in 2004 (ppm).....	V-24
Table V-12 Results of Analyses for CCME-TPH at the Experimental Landfarm in 2005 (ppm).....	V-24

Table V-13: Results of Analyses of Soil Samples for TPH from the Main Landfarm.	V-27
Table V-14: Soil and Air Temperatures at the Main Landfarm From 17 July to 6 September 2005 .....	V-29
Table V-15: Soil Nitrogen and Phosphorus Levels (ppm) at the Main Landfarm.....	V-30
Table V-16 Results of Analyses for Hydrocarbon Degraders at the Main Landfarm ..	V-30
Table V-17: Results of Analyses of Samples for CCME-TPH from the Main Landfarm (ppm).....	V-31
Table V-18: Soil Nitrogen and Phosphorus Levels (ppm) at the In Situ Landfarm .....	V-35
Table V-19: Results of Analyses of Soil Samples for TPH From the In Situ Landfarm..	V-37
Table V-20: Mass of TPH Collected on Charcoal Traps in the Reactors at 18°C from the Second Set of Experiments .....	V-46
Table V-21: Mass of TPH Collected on Charcoal Traps in the Reactors at 8°C from the Second Set of Experiments .....	V-46
Table V-22: Mass of TPH Collected on Charcoal Traps in the Reactors at 5°C from the Second Set of Experiments .....	V-47
Table V-23: Summary of Total Mass of TPH Collected on Charcoal Traps in the Reactors From the Second Set of Experiments.....	V-47
Table V-24: Summary of TPH Concentrations in the Reactors at the Start and End of the First of the Second Set of Experiments.....	V-48
Table V-25: Summary of Total Mass of TPH Lost From the Reactors During the Second Set of Experiments.....	V-49
Table V-26: Calculated Masses of TPH Lost Through Bioremediation.....	V-49
Table V-27: Rate Constants for the Experimental Landfarm .....	V-55
Table V-28: Rate Constants for the First Set of Laboratory Experiments.....	V-55
Table V-29: Rate Constants for the Second Set of Laboratory Experiments .....	V-56
Table VI-1: PCB Concentration of Sediment From the S1/S4 Valley Barrier .....	VI-8
Table VI-2: PCB Concentration of Filter Box Materials From the S1/S4 Valley Barrier System in Operation From 31 August 2004 to 28 July 2005.....	VI-9

Table VI-3: PCB Concentration of Filter Box Materials From the S1/S4 Valley Barrier System in Operation From 28 July 2005 to 26 August 2005.....	VI-10
Table VI-4: Metal Concentrations From the S1/S4 Valley Barrier System (ppm).....	VI-11
Table VI-5: PCB Concentration of Sediment Samples From the Furniture Dump Barrier System After Spring Runoff .....	VI-23
Table VI-6: PCB Concentration of Filter Box Materials From the Furniture Dump Barrier System in Operation From 9 July 2004 to 7 August 2005.....	VI-24
Table VI-7: Metal Concentrations the Furniture Dump Barrier System (ppm).....	VI-25
Table VI-8: Column Mass Balance Experimental Results. ....	VI-31

## LIST OF FIGURES

Figure V-1: Chromatogram of a Diesel Standard .....	V-6
Figure V-2: Schematic of the Pond and Barrier Systems .....	V-10
Figure V-3: Change of TPH with Time at the Experimental Landfarm .....	V-20
Figure V-4: Change of $C_{17}/Pr$ Ratios with Time at the Field Trial Landfarm .....	V-21
Figure V-5: Soil and Air Temperatures at the Field Trial Landfarm .....	V-21
Figure V-6: Change of $C_{17}/Pr$ Ratios with Time at the Main Landfarm .....	V-28
Figure V-7: Soil and Air Temperatures at the Main Landfarm .....	V-28
Figure V-8: Diagram of a Laboratory Reactor .....	V-39
Figure V-9: Change in the $C_{17}/Pr$ Ratio with Time for the 8 °C Reactor Set .....	V-43
Figure V-10: Change in the $C_{17}/Pr$ Ratio with Time for the Every Four Days and Fertilizer Added Reactor Sets .....	V-43
Figure V-11: Calculated Masses of TPH Lost Through Bioremediation .....	V-51
Figure V-12: $C_{17}/Pr$ Ratios for the Reactors at 18 °C .....	V-51
Figure V-13: $C_{17}/Pr$ Ratios for the Reactors at Three Temperatures to Which Nutrients Were Added and Which Were Rotated Every 12 Days or Not at All .....	V-52
Figure VI-1: Schematic of the 2004 Funnel and Gate System .....	VI-3
Figure VI-2: Arrangement of Filters and Sorbents in the S1/S4 Valley Filter Box at the End of the 2004 Field Season .....	VI-3
Figure VI-3: Arrangement of Filters and Sorbents in the S1/S4 Valley Filter Box during the 2005 Summer Field Season .....	VI-4
Figure VI-4: Arrangement of Filters and Sorbents in the S1/S4 Valley Filter Box at the End of the 2005 Field Season .....	VI-5
Figure VI-5: Arrangement of Filters and Sorbents in the S1/S4 Beach Filter Box at the End of the 2005 Field Season .....	VI-19
Figure VI-6: Arrangement of Filters in the Furniture Dump Filter Box at the Start of the 2005 Field Season .....	VI-21
Figure VI-7: Arrangement of Filters in the Furniture Dump Filter Box at the End of the 2005 Field Season .....	VI-21

Figure VI-8: Total ug of Aroclor 1260 retained by two different types of GAC (BC1240  
and CNS612).....VI-28



## LIST OF MAPS

Map I-1: Location and General Layout of the Site at Resolution Island .....	I-3
Map II-1: The S1/S4 Beach Area Showing the Contaminated Zones and the Quadrants at for the Start of the 2005 Field Season.....	II-9
Map II-2: The S1/S4 Beach Area Showing the Contaminated Zones and the Quadrants at the End of the 2005 Field Season .....	II-10
Map II-3: Contaminated Zones in the S1/S4 Buildings and Valley Vicinity for the Start of the 2005 Field Season .....	II-21
Map II-4: Contaminated Zones in the S1/S4 Buildings and Valley Vicinity for the End of the 2005 Field Season .....	II-22
Map II-5: Contaminated Areas in the PCL Dump Including New Sampling Points Before Excavation.....	II-30
Map II-6: Contaminated Areas and New Sampling Locations at the North Slope Dump Before Excavation.....	II-34
Map II-7: Sampling Locations and PCB Concentrations in the Vicinity of the Helipad .....	II-36
Map II-8: The Contaminated Maintenance Dump Drainage Pathway After Excavation Showing the Confirmation Sample Locations and Cobalt Concentrations .....	II-38
Map II-9: The Contaminated Area in the Beach Dump Showing the Grid Zones Established for Sampling Before and During Excavation .....	II-40
Map III-1: Monitoring Well and Associated Soil Sample Locations at the Tier II Landfill Site .....	III-8
Map III-2: Monitoring Well and Soil Monitoring Point Locations at the Airstrip Landfill .....	III-19
Map III-3: Monitoring Well and Soil Monitoring Point Locations at the Maintenance Dump.....	III-22
Map III-4: Locations and PCB Concentrations of Background Plant Samples Collected in 2005.....	III-42
Map V-1: Monitoring Points at the Pond and Barrier System in the Drainage Pathway Leading From the Imploded Tank .....	V-11

Map V-2: The Beach POL Area Showing Soil TPH Fuel Concentrations > 1000 ppm  
Remaining at the End of the 2005 Season and Areas Where Action Has Been or Will  
Be Undertaken ..... V-17