



## **APPENDIX 2**

### **SPILL CONTROL AND LOADING PROCEDURE PLAN**

## Dyno Spill Control and Loading Procedure Plan

- 1) All trucks are washed inside shop to contain any residue that may have contacted trucks. The water from the washing of the trucks and or the shop floors themselves is then picked up by the AEM e vacuum and disposed of in the onsite Stormwater Management Pond.
- 2) A.N. Prill is brought to the Emulsion Plant site in 20 ft Seacans and is stored in the Seacans on the A.N. Pad for the site till it is needed. It is then taken out of the Seacan /s and brought into the Plant for use. Sometimes enough product for the next batch is stored outside to speed up Batching time when it is necessary. A.N. Prill is not left outside if weather looks like it is going to be damp or raining to prevent the leaching of Prill through the Tote bags and on to the ground surface.
- 3) Any A.N. spills that occur are promptly cleaned up and disposed of in 1 of 2 ways:
  - i. Any contaminated prill is put into containment barrels or buckets inside Plant, depending on amount, and put into the next Ansol batch to be made.
  - ii. Any contaminated Prill is put in Barrels or Buckets (depending on amount) and then transferred from barrels to buckets for the Emulsion Truck Operators to take to the Blast Pattern and placed into the boreholes after they have been loaded (disposal via blast).

Any spills that are too difficult (some of our drummed Products) to take care of in this manner are placed in Metal Drums or HAZMAT bins etc. with absorbing materials, sealed and sent to AEM HAZMAT AREA (for shipment south).

- 4) Emulsion waste (with contaminants) is also either contained in drums or bins until it can be transferred into buckets and taken to Blast patterns and placed into boreholes for disposal (disposal via blasting).

Any non contaminated Emulsion is put back through the system and on to Trucks.


When Trucks need to be de-contaminated or process lines of trucks or plant need to be cleaned out, the excess water is strained through a Sack (this allows the water to go through, but contains the Emulsion) to minimize nitrites in our plant sump containment.

- 5) When an Emulsion Truck has completed loading on a blast pattern the remaining emulsion is flushed out of the loading hose by running water through the hose (water holding tank on trucks) until water discharges out the end of the hose into the borehole.

This does not completely remove all of the Emulsion out of the Hose; there is still a residue amount left in the hose. Thus, when the Truck operator starts up on the next blast pattern, the hose is put into the borehole and the Operator primes the hose and all the residue Emulsion is contained in borehole and disposed of when hole/s are blasted.

## **APPENDIX 3**

### **DYNO NOBEL EMERGENCY RESPONSE PLAN – MAGAZINE, PLANT AND WORK SITE**

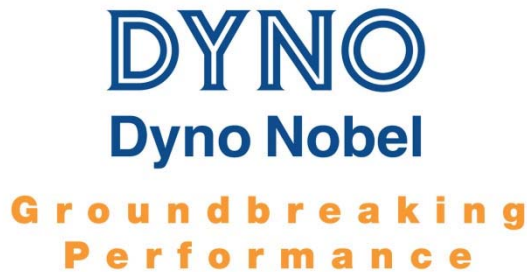

**EMERGENCY RESPONSE PLAN**  
**QAAQTUQ**  
**Agnico Eagle Meadowbank (Baker Lake)**  
**Nunavut**

For Dyno Nobel Canada Inc.

**Magazine, Plant and Work Sites**

**This Emergency Response Plan (ERP) addresses incidents and potential incidents involving the manufacturing, handling and storage of explosives and related products in Dyno Nobel Canada Inc.' magazines, plants and worksites. This ERP has been developed for Dyno Nobel Canada Inc. and all of its wholly-owned subsidiaries (DNX Drilling). Actions detailed within this plan are compulsory, under the approval and authorization of DNCI's Regional Operations Managers.**

"This document, as presented on Dyno Nobel's database, is a controlled document and represents the version currently in effect. All printed copies are uncontrolled documents and may not be current".

Note: Information provided within this document may be privileged and is not intended for general distribution.

Original Date of Publication: 15 October 2003, as amended site specific, December 19, 2011

<u>Publication/ Amendment Date</u>	<u>Changes To Prior Edition</u>	<u>Pg.</u>
15 Oct 03	<b>New document</b>	All
26 Apr 04	<b>Amendment # 1</b>	
	Renumbering of Appendices 6 – 13	App. 7 – 14
	Miscellaneous Typos & Amendment Dates	All
17 March 08	<b>Amendment #2</b>	
	Updated Contact information	
	Addition of definitions	
	Included Calling and responding emergency procedures	
	Addition Duties of Key personnel	
	Addition of response to Natural disasters	
	Addition of visitor and contractors access control -	
	Replaced the Appendices and renumbering	
	Included a Emergency Report form	
	Addition of Nitric acid, Aluminum and Diethylene glycol and CFE	
	Addition of alternate methods of communication	
	Addition of Reportable Substance list	
	Miscellaneous Typos & Amendment Dates	All
August 18, 2010	<b>Amendment #3</b>	
	Updated Scope and ERP Outline	
	Added Sign-off sheet for Annual Fire Department Review	
	Added Appendix for Employee Training sign-off	
	Updated Reporting Incidents Flowchart	
	Updated procedure for Raw Material Truck Spills	
	Updated Bomb Threat Checklist	
September 29, 2011	<b>Amendment #4</b>	
	Updated contacts and phone numbers	
November 15, 2011	<b>Amendment #5</b>	
	Amended Appendix 8	
	Addition of Appendix 10	

## Table of Contents

<b>Section</b>	<b>Topic</b>	<b>Pg.</b>
1.0	Scope	4
2.0	Related Documents	4
3.0	ERP Outline	4
4.0	Preparation and Planning	6
5.0	Training	7
6.0	Emergency Procedures and Lines of Authority	8
6.1	Duties Of Key Personnel	8
Table 6-1	Flow Chart	9
6.2	Fire & Explosives	13
Table 6-2	Fire Fighting Information	15
Table 6-3	Control Measures	16
Table 6-4	Evacuation Distances	17
6.3	Environmental Releases	18
Table 6-5	Environmental Release Procedures	20
6.4	Security	21
6.5	Bomb Threat	21
Table 6-6	Bomb Threat – Conversation Guidelines	21
6.6	Lines of Authority	22
7.0	Notification and Reporting	23
Table 7-1	Reportable Substances Quantity List	25
8.0	Decontamination	27
9.0	Work Site Closure / Shut Down	27
10.0	Response to Natural Disaster Preventive Measures	28
11.0	Work Site Start Up	29

### **Work Site Phone Numbers and Magazine / Plant Details**

- Appendix 1 DNCI Emergency report form
- Appendix 2 DNCI Corporate Contacts
- Appendix 3 ERA Contact List
- Appendix 4 Management and Site Contact list
- Appendix 5 Site Specific Information
- Appendix 6 Bomb Threat Checklist

- Appendix 7 New/Transferred Employee or Annual Refresher Form
- Appendix 8 Annual Fire Department Review Form / Debrief Form
- Appendix 9 TDG Regulation Class Quantity Emission Limit

## **1.0 SCOPE**

This document provides a Work Site Emergency Response Plan covering fire/explosion, spills, security breach, bomb threat, evacuation and prescribed actions that employees must take to ensure employee and public safety in the event of an emergency. The general reference to DNCI's "Work Sites" throughout this document includes magazines, plants and miscellaneous work locations.

The Emergency Response Plan appearing on Dyno Nobel Canada Inc.' database is a controlled document. Uncontrolled copies of this ERP are provided to customers and associates who own the land on which DNCI's worksite is located, plus applicable municipal and regulatory authorities. As well, uncontrolled copies are issued to all Company employees and are placed in all central offices and Company delivery vehicles.

## **2.0 RELATED DOCUMENTS**

The following documents also relate to emergency situations that can arise and should be held at each Work Site:

- Federal, Provincial and Municipal regulations, standards and guidelines
- Corporate Policies plus MSA Standards & Procedures
- Standard Operating Procedures (SOP's)
- Dyno Nobel General and Specialized Work Rules
- Material Safety Data Sheets
- Prime Contractor's / Customer's ERP
- Transportation ERAP #2-1037
- Crisis Communication Plan

## **3.0 ERP OUTLINE**

3.1 The following materials are covered by this ERP:

Fuel Oil  
ATF Hydraulic Fluid  
Ammonium Nitrate Prills and Solution  
Sodium Nitrite  
Sodium Thiocyanate  
ANFO  
Emulsion



Packaged Explosives  
Detonators  
Acetic acid  
Diethylene glycol  
Aluminum  
Enviro CFE

3.2 The following situations are addressed in this ERP:

- Fire / Explosion
- Storage Tank Failure
- Spills from Product Delivery Trucks
- Spills from Raw Material Delivery Trucks
- Process Spills
- Shut down due to weather, floods, lightning, fires, explosions and other threats to the security and operation of DNCI's facilities, equipment and material.
- Bomb Threats
- Quantities of spills and reportable to Dyno Nobel and authorities

3.3 This ERP covers:

Preparation	Reporting
Training	Waste Disposal Permits
Lines of Authority	Containment
Notification	Inspection
Decontamination	Maintenance

3.4 The following definitions apply to this plan:

DNCI Corporate contact : A DNCI corporate employee who is assigned to receive Emergency Calls at all times from the answering service.

ER Advisor: Emergency Response Advisor (ERA), who will normally be the applicable General Manager, Area Manager, or Technical Advisor who will liaise with First Responders.

OSC: (DNCI) On Scene Coordinator, the Senior DNCI employee at an incident site who manages and controls DNCI resources in support of First Responders and incident recovery.

ERT: Emergency Response Team, DNCI personnel dispatched to an incident site to assist First Responders and conduct incident recovery under the direction of the OSC.

## 4.0 PREPARATION AND PLANNING

- 4.1 In order to provide competent emergency response at Dyno Nobel Canada Inc.' magazines, plants and worksites, first responders (local fire departments and mine rescue personnel) must be thoroughly briefed on an annual basis of the potential hazards involved in a Dyno Nobel Canada Inc. worksite fire. To this end, Work Site Supervisors must take fire department plus mine safety and security representatives on an annual magazine / plant tour to view:

Explosives Storage Areas	Evacuation (Meeting) Area
Bulk Emulsion Equipment	Communications Equipment
ANFO Blending Area	Facility Layout
Fire Fighting Equipment Sites	(Waste) Burn Facilities

A record of each explosives worksite tour and the names of the first responder representatives attending are to be documented and kept on file.

Annual Fire Department Review Form (Appendix 9)

- 4.2 All DNCI employees shall review this ERP on an annual basis and participate in ERP drills / exercises when scheduled.
- 4.3 All worksite accidents involving fire, explosion, reportable spills/emissions, breaches of security and bomb threats are to be reported to applicable authorities and senior management. As per incident reporting procedure
- 4.4 Spill procedures for each of the materials listed in section 3.1 are outlined in Table 6-3. All procedures specify: Method of Cleanup, Method of Disposal and Protective Clothing. Based on the procedures presented in Table 6-3, worksite supervisors must ensure that adequate clean-up equipment and materials are readily available and in good condition.

- 4.5 Worksite information for each of DNCI's facilities is contained in the attached appendices. The ERP is revised whenever significant changes are made.
- 4.6 Current Material Safety Data Sheets (MSDS) are to be kept at each Work Site for all hazardous materials that are stored and handled at the Work Site. Copies of current product MSDS' are also made available to customers and landowners. Obsolete MSDS' will be replaced as new ones are issued.
- 4.7 Each Work Site will hold and maintain in good repair, appropriate fire fighting and spill control equipment for potential emergencies. Fire extinguishers, hoses and other fire fighting equipment are to be visually inspected on a monthly basis to ensure Magazine, Plant, Work Site and delivery vehicle readiness.

## 5.0 TRAINING

- 5.1 All employees will complete training on the contents of this Plan during their "new hire" orientation and review the plan annually.
- 5.2 A trained person is considered to have reviewed all related documents (Section 2.0), to have been instructed on the use of related equipment and procedures, and to have discussed with their Supervisor or trainer, questions and issues of concern.
- 5.3 Training records, including certificates for training completed, are to be kept onsite in the Employee's Training Record.
- 5.4 The Magazine, Plant or Work Site Supervisor/Manager will certify their employees as having received training by signing the training form. In signing the training form, the Supervisor / Manager will have satisfied themselves that trained employees are able to:
  - Recognize fire and explosive hazards for the materials and processes to which they are exposed /involved with;
  - Competently use Fire Fighting / Fire Protection Equipment (Note: employees should receive refresher training in the use of fire extinguishers at least every three years)
  - Competently use applicable personal protective equipment (PPE) when handling hazardous substances;
  - Recognize and be familiar with substances which become hazardous wastes when spilled; and

- Follow SOP's and use established work practices to minimize the potential for fires, explosions, environmental releases and other accidents.
- Worksite Managers / Supervisors will ensure that all contractors receive a worksite orientation before commencing work or being left unaccompanied in the worksite. Following the orientation process, the contractors will be required to sign off on the Contractor Checklist acknowledging training in the applicable areas including the site emergency response plan.
- All Plant & Magazine sites will have in place, a continuous (24 hour) access control system to control the entrance, presence and exit of visitor and contractors and their equipment and materials
- Employees must be trained on Reportable Quantities to the Government in the unlikely event of a spill.
- All employees are aware of evacuation routes, muster point location, and all-clear notice procedure.
- New/Transferred employee or Annual Refresher sign-off form located in Appendix 8

## **6.0 EMERGENCY PROCEDURES AND LINES OF AUTHORITY**



### **6.1 GENERAL**


Reporting Incidents Flow Chart (continued on next page)

Table 6-1  
Emergency Response Flow Chart

# Reporting Incidents

## Property Loss/Fly Rock/Environmental Spill/Injury

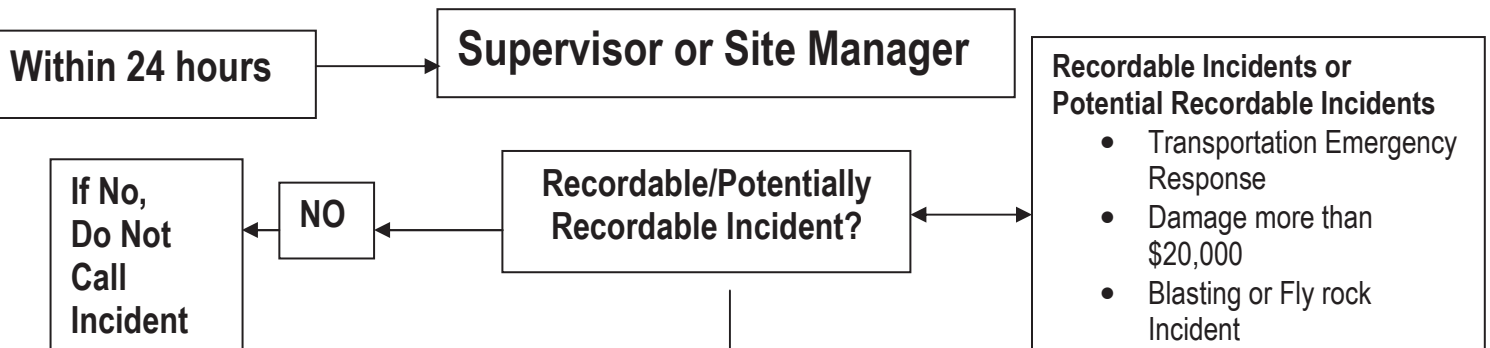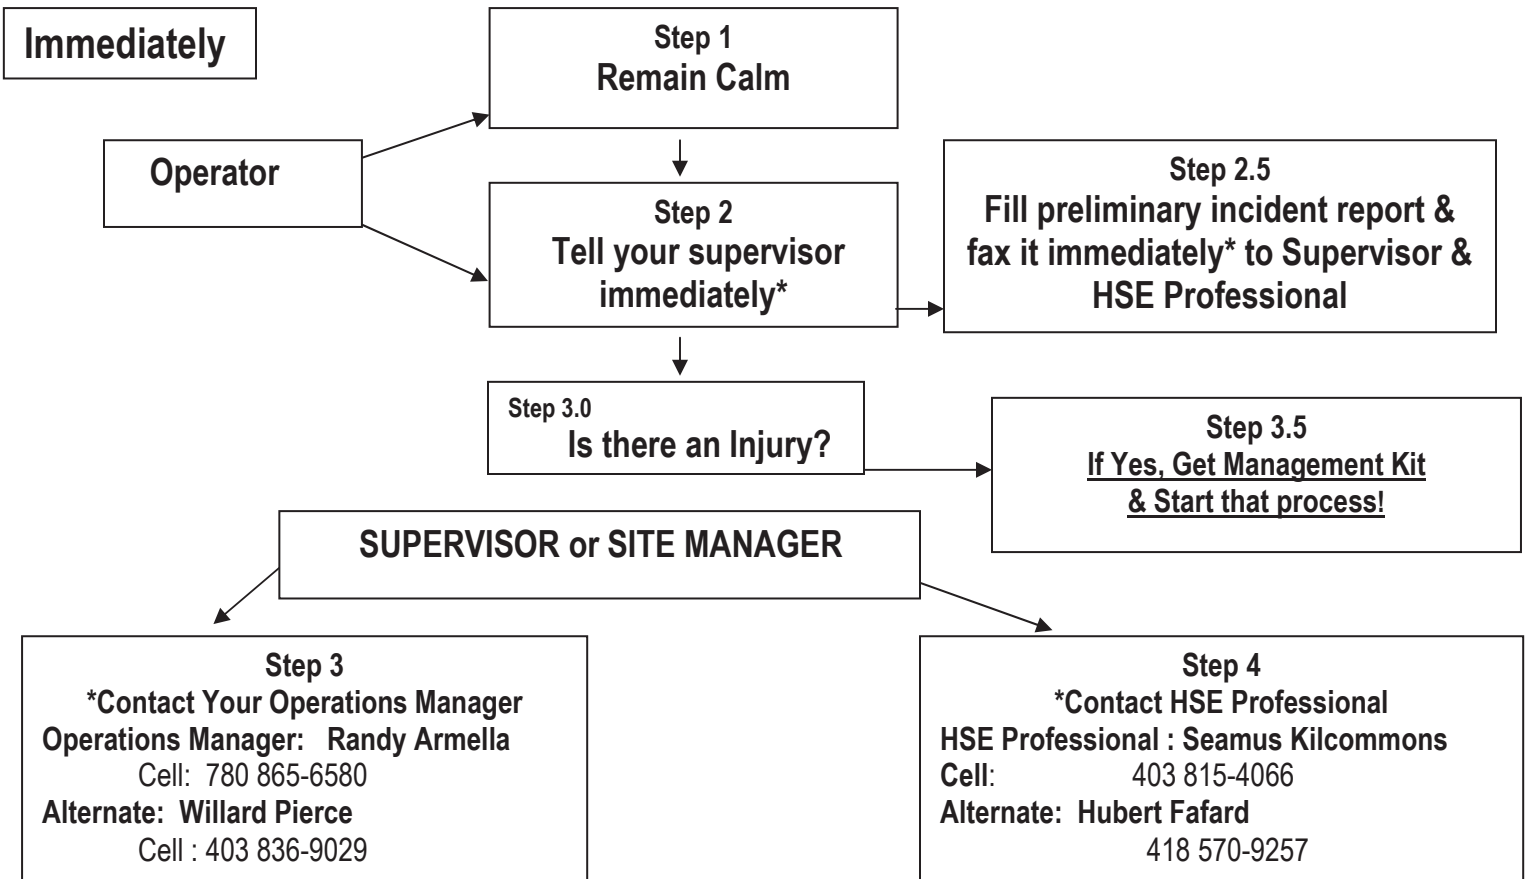

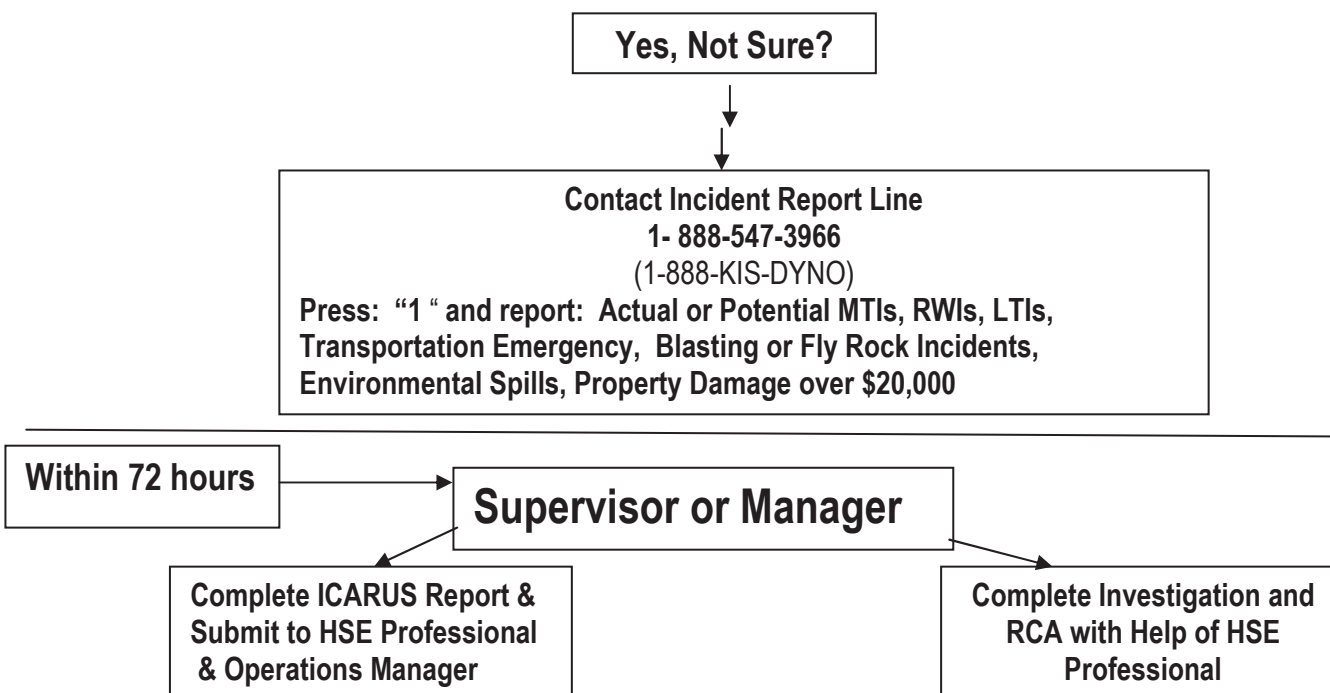

**SITE SUPERVISOR/DELAGATE**  
**EXPERIENCING EMERGENCY / POTENTIAL EMERGENCY**

- **CALL FOR EMERGENCY ASSISTANCE**  
In the event of an emergency, accidental release or imminent accidental release involving explosives, eliminate potential sources of detonation where possible (eg. turn off the ignition of a vehicle), call **911** (or the local police number) for immediate assistance, **call the site Supervisor/ Area Manager** and initiate the site's Emergency Response Plan. If normal phone systems are down other methods of communication can include two way radios, satellite phones, pager, e mail and vehicle satellite tracking systems.
- **WARN PUBLIC WITHIN EVACUATION DISTANCES IF RISK OF DETONATION**  
Should there be explosive detonations, or the risk of detonations due to the presence of fire or other detonating factors, advise the First Responders (or anyone within the immediate vicinity if First Responders are not at the scene) of the risk and applicable safety distances per Table 6-4, page 17 (liaise with Emergency Response Advisor (ERA) if time permits). Help organize perimeter guards to prevent people from entering the evacuation zone.  
Note: See ERP, page 17 Table 6-4 for Evacuation Procedures.

- **ASSIST LOCAL AUTHORITIES**

Assist First Responders and Local Authorities in eliminating the emergency situation, and liaise with DNCI's On-Call Employee / ERA until relieved by the Company's Emergency Response Team (ERT).

## **TO RESPOND TO AN EMERGENCY CALL**

### **DNCI Corporate contact instructions:**

Upon receiving a call for emergency response assistance, keep a log of all subsequent communications and actions, and do the following:

1. Immediately obtain the name and callback number of the caller, in case the telephone line is lost.
2. Obtain information as fully and accurately as possible following the emergency report form (see appendix 1).
3. Call an ER Advisor for the applicable Region (see appendix 2) and report the emergency situation. In turn, the ER Advisor will phone the emergency scene caller, establish ongoing contact, assess the emergency, determine what Company resources and/or contracted emergency response services are required and organize an Emergency Response Team – ERT to proceed to the emergency scene if required.
4. Assist the Emergency Response Advisor (ERA).
5. Liaise with Company Executive / Senior Managers.

### **Emergency Response Advisor (ERA) instructions:**

1. Call the Branch/Plant Supervisor nearest the emergency scene plus provincial & federal authorities (see applicable appendix to Annex D) to advise them of the situation and the need for an emergency response.
2. Designate, assemble and dispatch an Emergency Response Team (ERT), made up of Groups 1 & 2 personnel (see ERAP pg. 16 and Annex D) under the leadership of an On Scene Coordinator (OSC), if required.
3. Authorize the dispatching of additional resources, communications, transportation and contracted services as necessary.
4. Contact and instruct the designated Emergency Response Team (ERT) to proceed to the emergency scene with the required vehicles and equipment.

5. Liaise with the Person in Charge of the Emergency) and/or Local Authorities to obtain a situation update.
6. Advise Local Authorities as appropriate, regarding the properties, hazards and handling procedures for the explosives involved in the emergency. In particular, advise the Local Authorities of appropriate evacuation distances per Table 6-4 pg. 17.
7. Continue to consult with the Local Authorities as appropriate, plus the Company's On-Scene Coordinator (OSC), to stabilize and eliminate the emergency.
8. Refer to **Regional Manager** Tom Medak or Cory Redwood .(see appendix2)) for any media requests in accordance to the Crisis Communication Plan (CCP). Media contacts shall be through Regional Manager designated for the area.
9. Contact the explosives supplier and / or transporter (if other than DNCI) to advise them of the emergency and to request their assistance if/as required.

#### **ON-SCENE CO-ORDINATOR (OSC)**

- The On-Scene Coordinator (OSC) is the Company's representative and local authority in charge of all company actions and resources at the emergency scene. Once the OSC arrives at the emergency scene, the ERA will transfer communication with First Responders/Local Authorities to the OSC. In turn, the OSC will liaise with the ER Advisor as required. Throughout the Company's emergency response, the OSC will ensure that First Responders and Company personnel (employees and contractors) observe all safety and regulatory standards and procedures.
- The OSC may revise / adjust the composition of the Emergency Response Team (ERT) and supporting resources as required. The OSC may, in consultation with the ER Advisor, contract commercial services to assist in addressing and resolving the emergency situation.
- The OSC will oversee the Company's local involvement with emergency services, government (municipal & provincial) and public interests until the emergency is fully resolved. Post-emergency activities (clean-up, restoration, etc.) under the direction of the Environment Manager may be delegated to an appropriate Branch, Plant or Area Manager. **EMERGENCY RESPONSE TEAM (ERT)**
- Selected emergency response personnel will take their direction to assemble and proceed to the emergency scene from the ERA or their representative. Team members will immediately report to the On-Scene-Coordinator.
- The primary role of the ERT is to provide a competent and trained / certified workforce plus specialized equipment and material to assist First Responders / Local Authorities in the stabilizing and elimination of an 'explosives emergency', and to retrieve / recover, repackage and remove to safe and secure storage, non-detonated explosives.



- While at the emergency scene, ERT members will take their direction from the Company's OSC and remain available until released by the OSC.

**NOTE:**

**ONLY INDIVIDUALS WHO HAVE RECEIVED TRAINING AS REQUIRED UNDER THE TRANSPORTATION OF DANGEROUS GOODS (CLEAR LANGUAGE) REGULATIONS, OR WHO ARE WORKING UNDER THE DIRECT AND CONTINUOUS SUPERVISION OF AN EMPLOYEE WHO HAS BEEN TRAINED FOR CLASS 1 DANGEROUS GOODS UNDER TDG, MAY PARTICIPATE IN SITE CLEAN-UP ACTIVITIES SUCH AS PICKING UP, REPACKAGING AND TRANSPORTING EXPLOSIVE MATERIAL.**

6.1.1 In any emergency the Work Site Supervisor/Manager or their delegate must take certain actions, including the following:

- Call local fire/emergency authorities (at mine sites, also call Mine Fire, Safety and Security if different and give relevant information).
- Account for all employees and visitors. Arrange for Rescue of anyone who may be trapped, without endangering oneself or others.
- Notify Dyno Nobel Canada Inc. ERA's so that necessary arrangements can be made for technical / administrative support, including accident reporting and investigation plus continued/alternate production. The following information should be provided and refer to appendix 1:

What Occurred	Time of Occurrence
Action Taken	People Contacted
Status of Situation	Anticipated Follow-up

## **6.2 FIRE & EXPLOSIVES**

6.2.1. There are three categories of fire that may involve explosives:

I. Fires Directly Involving Class 1 Explosives and Blasting Agents

- **DO NOT FIGHT THE FIRE.** Instruct all fire fighters on the scene not to fight fire with explosives.

- Shut off power at main breakers if possible. At mine sites, call Mine Security or Fire/Rescue. At all other DNCI locations call local Fire/Rescue personnel.
- Evacuate all personnel from the Work Site to the safe meeting place as outlined in the Work Site Appendix.
- Set up a communications base at the meeting place and guard against anyone entering the area.

**II. Fires Involving Components For Manufacture of Blasting Agents**

Bulk blasting agents may be in the form of emulsion or ANFO. ANFO is a mixture of prilled ammonium nitrate and fuel oil.

Under conditions of large mass, intense heat, confined dust / vapor buildup, and the right mixture combination of the basic ingredients, emulsion and ANFO will explode. The probability of explosion with ammonium nitrate (AN) alone is very small, but increases when under intense heat and confinement. Table 6-1 includes recommended fire fighting procedures for each of these substances.

**III. Fires Involving Dyno Nobel Canada Inc. Trucks**

In cases where the Dyno Nobel Canada Inc. delivery trucks are in a building that is on fire, if there is no explosives and safe to do so, may be moved provided access to the truck and exit from the building is not barred by flames or smoke, with available fire extinguishers with caution only if the fire is small and not in the storage compartment.

Fires on re-pump or other bulk explosive delivery vehicles shall not be fought if the fire involves the explosives compartment. Fire fighting measures should be taken immediately to prevent any fire such as a tire, electrical or cab fire from reaching the explosives compartment.

Fires on other transport vehicles may be fought with caution. Fires that cannot be controlled sufficiently to avoid involvement of the vehicle's fuel compartment shall be left and personnel evacuated to a safe distance.

- 6.2.2.** When a fire is small and does not involve any explosive agents, it may be fought with plant extinguishing equipment. If the fire is widespread and intense, all

personnel, including visitors and contractors should be evacuated to the meeting area outside the main gate.

**Table 6 - 2**  
**FIRE FIGHTING INFORMATION**

<b>MATERIAL</b>	<b>RECOMMENDED FIRE-FIGHTING METHODS</b>	<b>SPECIAL CONSIDERATION</b>
Ammonium Nitrate Prill – Odorless white to light tan crystalline solid	Use flooding amounts of water in early stages of fire. Keep upwind. AN is an oxidizing agent which supports combustion and is an explosive hazard if heated under confinement that allows high-pressure buildup. Ensure good ventilation and remove combustible materials if it can be safely done. Evacuate to designated area if fire cannot be controlled.	Toxic oxides of nitrogen are given off during combustion. Fire fighters require self-contained positive pressure breathing apparatus. Avoid contaminating with organic materials. Many powdered metals such as Al, Sb, Si, Cd, Cr, Co, Cu, Fe, Pb, Mg, Mn, Ni, Sn, Zn and brass react violently and explosively with fused AN below 200°C Sensitivity to detonation increases when heated.
Ammonium Nitrate Solution- Colorless/Odourless Liquid – white paste like solid when cooled	Use flooding amounts of water in early stages of fire. Cool containing vessels with with flooding quantities of water until after fire is out	Material will not burn, but thermal decomposition may result in flammable/toxic gases being formed. These products are nitrogen oxides and ammonia. (NO,NO <sub>2</sub> NH <sub>3</sub> ). Product may form explosive mixtures when contaminated and comes in contact with organic materials. Explosive when exposed to heat or flame under confinement. Avoid temperatures over 210°C (410°F) A self contained breathing apparatus should be used to avoid inhalation of toxic fumes
Acetic Acid – Colourless liquid with a pungent odour	Use dry chemicals, CO <sub>2</sub> , Alcohol foam or water spray	Isolate and restrict area access, stay upwind. Water run-off and vapour cloud may be corrosive.
Sodium Thiocyanate – White solid - odourless	Use extinguishing media most appropriate for the surrounding fire	Wear self contained breathing apparatus – MSHA/NIOSH approved or equivalent, and full protective gear. During a fire, irritating or highly toxic gases may be generated by thermal decomposition or combustion.
Sodium Nitrite – Oxidizing agent - white to light yellow crystals- faint odour	Flammability class – not regulated. Flood with water only – Isolate materials not involved in the fire and cool containers with flooding quantities of water until well after the fire is out.	Self contained apparatus should be worn in a fire involving Sodium Nitrite. Thermal decomposition will cause reddish brown nitrogen oxides to be released.
Fuel Oil (No. 2 diesel) Dyed or pale yellow liquid with petroleum odor; and/or ATF Fluid	Use water spray to cool fire-exposed surfaces and to protect personnel. Shut off fuel from fire. Use foam, dry chemical or water spray to extinguish fire. Avoid spraying water directly into storage container due to danger of boil-over.	Avoid strong oxidizing agents.

Explosive emulsions, ANFO, packaged explosives and firing devices.	<b>Fire involving explosive materials must never be fought. Evacuate the incident scene. Do not confine (ventilate to prevent / reduce pressure build-up if safe to do so).</b>	Explosion hazard.
Enviro CFE	Dry chemical, foam, water spray (fog). Use water spray to cool exposed surfaces and containers	OIL FLOATS ON WATER. Do not use direct or heavy water stream to fight fire. Use organic vapour respirator or self-contained breathing apparatus to fight fire.

**Table 6 - 3  
CONTROL MEASURES FOR FIRE**

<b>MATERIAL</b>	<b>RECOMMENDED FIRE-FIGHTING METHODS</b>	<b>SPECIAL CONSIDERATION</b>
Acetic acid	Small fire: type ABC dry chemical or CO <sub>2</sub> fire extinguisher. Large fire: water fog or foam.	May react violently with oxidizers and nitric acid. May react with aluminum powder and give off highly flammable hydrogen gas.
Aluminum	Small fire: type D fire extinguisher, dry sand. <b>Never use water.</b>	May react with oxidizers (nitrate and perchlorate) and acids. Avoid contact with water. Highly flammable hydrogen gas may be released.
Diethylene glycol	Small fire: type ABC dry chemical or CO <sub>2</sub> fire extinguisher. Large fire: water fog.	Keep away from oxidizers (nitrates and perchlorate). Explosion hazard if heated under confinement.

## EVACUATION PROCEDURES

Advise the first emergency responders at the scene (police or fire) of the need to evacuate using the guidance in the Emergency Response Plan. Employees at the scene should assist local emergency services to the best of their ability to accomplish this. For incidents within a worksite such as a mine, quarry or construction operation, in most cases access is radio controlled. The quickest way of alerting people, therefore, is by site radio. Clearly state your location, situation and call for assistance in evacuating the area.

**DO NOT FIGHT EXPLOSIVES FIRES. EVACUATE THE AREA AND LET THE FIRE BURN ITSELF OUT.**

**THE MINIMUM EVACUATION DISTANCE IS AS OUTLINED IN TABLE 6-4 (Pg. 17) FOR ALL DIRECTIONS** (which is based on a higher traffic / risk / population density within the area, without benefit of protective features such as berms and hills. (**Transport Canada requires 1,600 meters for situations that involve high-risk surroundings**) upon determining actual quantity of explosives refer to Table 6-4 as per ERD quantity of distances.

**Table 6 - 4**  
**EVACUATION DISTANCES**  
**Based On Amount of Explosives Present**

<b>Explosive <u>Quantity</u></b>		<b>Metric <u>Distance</u></b>		<b>English <u>Distance</u></b>
250 kg		70 Meters		230 Feet
500 kg		100 Meters		320 Feet
1,000 kg		150 Meters		500 Feet
2,000 kg		240 Meters		800 Feet
5,000 kg		400 Meters		1,300 Feet
7,000 kg		450 Meters		1,450 Feet
10,000 kg		480 Meters		1,550 Feet
20,000 kg		700 Meters		2,300 Feet
40,000 kg		800 Meters		2,640 Feet
60,000 kg		870 Meters		2,860 Feet
80,000 kg		960 Meters		3,150 Feet
100,000 kg		1040 Meters		3,420 Feet
120,000 kg		1100 Meters		3,610 Feet
>120,000 kg		1600 Meters		5,250 Feet

## **6.3 ENVIRONMENTAL RELEASES**

### **6.3.1 Procedure For Fuel Oil Storage Tank Failure**

- Assess the magnitude of the leak.
- If the leak is slow and the source can be determined, take the appropriate action to prevent further leakage.
- Transfer fuel from storage tank into drums if necessary.
- Collect spilled material, including contaminated soil, with absorbent pads or inert solid absorbent and store in drums labeled for disposal.
- If the leak is large and further leakage cannot be prevented, allow the dyke to fill. Transfer to drums, label for reuse or disposal, and store.
- Inspect empty tank to identify failure/cause of leak and repair tank.

### **6.3.2 Procedure For Raw Material Truck Spills**

- Identify the material involved, assess the magnitude of the spill or leak and assist the driver to take appropriate action to stop the leak, taking care to prevent run off and/or entry into any water course or drainage system near the spill site.
- For AN prill, shovel spilled material into drums, label for reuse or disposal, and store. Use a non-sparking shovel to transfer spilled material into lined drums.
- For spilled fuel, contain by dyking with earth. Collect spilled fuel with absorbent pads or solid inert absorbent, transfer into drums, label and store for disposal.
- Remove contaminated soil for disposal in conformance with Environment Canada standards.

### **6.3.3 Procedure For Process Spills**

- Identify the material involved and assess the magnitude of the spill or leak, taking care to prevent run off and/or entry into any watercourse or drainage system near the spill site.
- For AN prill, shovel spilled material into drums, label for reuse or disposal, and store.
- For spilled fuel, contain by dyking with earth. Collect with absorbent pads or solid inert absorbent, transfer into drums, label, and store for disposal.
- In the case of leaking bags of ANFO, sweep or shovel the spilled material into a clean drum or other suitable container, label for reuse or disposal, and store.
- Remove contaminated soil for disposal in conformance with Environment Canada standards.

- Have any process equipment (pumps, process lines, parts, gauges, etc.) involved in a leak or spill inspected and repaired or replaced. Re-inspect and test if necessary after repair is affected.

#### 6.3.4 **Procedure For Emulsion Tank Failure**

- Assess the magnitude of the leak.
- If the leak is slow and the source can be determined, take the appropriate action to prevent further leakage.
- Transfer remaining emulsion from leaking storage tank into another storage tank, a tanker trailer if available, or into drums as necessary.
- Collect spilled material using double diaphragm pump(s) and store in labeled drums for reuse or disposal at the mine.
- If the leak is large and further leakage cannot be prevented, allow the room to fill. Transfer to drums, label for reuse or disposal, and store.
- Inspect empty tank to identify failure/cause of leak and repair or replace the tank

#### 6.3.5 **Procedure For Fire**

- In the event of a raw material or product fire, take care to protect all persons from exposure to smoke and gaseous emissions from the fire.
- Potential toxic gaseous emissions from fires involving explosive materials include:

Oxides of Nitrogen  
Carbon Monoxide  
Cyanide Gas

- All fires must be reported to local authorities and Mine Site Security as soon as possible.
- Self contained breathing apparatus is required for fighting a fire in the plant.
- Follow procedures outlined above for any spills and leaks resulting from fire when it is safe to do so



**Table 6 - 5**  
**ENVIRONMENTAL RELEASE PROCEDURES**

<b>MATERIAL</b>	<b>SPILL AND LEAK PROCEDURES</b>	<b>WASTE DISPOSAL</b>
Ammonium Nitrate Prill (odorless white to light tan crystalline solid)	Remove source of heat and ignition. Sweep or shovel spill into a clean, non-combustible container. Wash remaining trace residues with water. Wear rubber gloves and safety glasses to minimize contact with skin and eyes.	Re-use if possible or give it to a farmer as a fertilizer. If not possible, dispose of as-is in approved. Remove as much as possible the spilled material as a solid.
Ammonium Nitrate Solution- Colorless/Odourless Liquid – white paste like solid when cooled	Small spill - Dike and contain spilled material. Ensure spilled material does not enter sewers, wells or water courses. Allow to solidify. Use appropriate tools to place in container for disposal. Larger spill - Dike and contain spilled material. Ensure spilled material does not enter sewers, wells or water courses. Notify downstream water users. Allow to solidify. Use appropriate tools to place in container for disposal.	Call for assistance for disposal. Ensure disposal complies with regulatory requirements and regulations.
Fuel Oil (dyed or pale yellow liquid with petroleum odor)	Eliminate any source of ignition. Prevent spills from entering watercourses or drainage systems. Contain with sand or earth. Recover with pump or inert absorbent material into clean container. Wear safety glasses and rubber gloves to prevent contact with the eyes and skin.	Dispose of recovered material in approved landfill or other waste disposal facility.
ANFO (Ammonium Nitrate Fuel Oil)	This material is an explosive. Remove all sources of heat and ignition. Transfer into clean plastic container with a plastic shovel. Label drums. Wear rubber gloves.	Recycle product, if possible. If not practical, explode it inside a borehole or burn it in an authorized burning ground.
Emulsion	This product is a blasting agent. Remove all sources of heat and ignition. Prevent spills from entering watercourses or drainage systems. If large amount of emulsion is involved, contain spill with earth or sand found locally. Recover spilled material with a diaphragm pump. Use of a diaphragm pump also requires an air compressor. Limitation of the pump suction is approximately 2.5 meters, pump discharge is approximately 8 meters. Use a screening device on pump suction hose. Out of area spills will require taking two pumps and extra hose. Transfer the product into a tanker trailer or clean 200 liter drums. If small amount of emulsion is involved, transfer material into a clean plastic container with a plastic shovel. Label tanker trailer or drums. Wear rubber gloves and rubber boots.	Recycle product, if possible. If not practical, explode it inside a borehole or if large amount is involved, demulsify it with liquid detergent.



Enviro CFE	Eliminate any source of ignition. Prevent spills from entering watercourses or drainage systems. Contain with sand or earth. Recover with pump or inert absorbent material into clean container. Wear safety glasses and rubber gloves to prevent contact with the eyes and skin.	Dispose of recovered material in approved landfill or other waste disposal facility.
Sodium Thiocyanate – White solid - odourless	Ensure adequate ventilation whe handling Sodium Thiocyanate. Keep containers closed when not in use. Wear appropriate PPE – eye protection, gloves and appropriate clothing to prevent skin exposure.	Vacuum or sweep up material and place into a suitable disposal container. Avoid run off into storm sewers and ditches which lead to waterways. Not regulated as a hazardous material. Chemical waste generators must consult appropriate hazardous waste regulations to ensure complete and accurate classification.
Sodium Nitrite – Oxydizing agent - white to light yellow crystals- faint odour	In the event of a spill or leak, contact the vendor (403-263-8660) for advice. Wear respirator, protective clothing and gloves. Vacuuming is the recommended method to clean up spills. Do <b>not</b> sweep or use compressed air for clean up. Recover spilled material on non-combustible material, such as vermiculite. Use non-sparking tools and place in covered containers for disposal. Any recovered material mau be used for it's intended purpose , depending on contamination.	Dispose of the waste material at an approved hazardous waste treatment/disposal facility.
Acetic Acid – Colourless liquid with a pungent odour	Wear appropriate PPE – evacuate downind areas as required to prevent exposure and to allow fumes and vapours to dissipate. Prevent entry into sewers or streams. Dike if needed. Eliminate all sources of ignition. Neutralize the residue with sodium carbonate or crushed limestone. Absorb win an inert dry material and place in an appropriate container for disposal. Flush area with water to remove trace residue.	Waste disposal must be done in accordance with provincial and federal regulations. Empty containers must be recycled or disposed of through an approved waste management facility.

## 6.4 SECURITY

- 6.4.1. In the event of a breach of security at a Dyno Nobel Canada Inc. Work Site, a call is to be made to the RCMP / local Police Department at the discretion of the Supervisor/Manager, or their delegate. In the case of a breach of security, Dyno Nobel Canada Inc.' HSE, Regulatory Affairs and Executive / Senior Management shall also be informed immediately and provided with the same information as outlined in Section 6.1
- 6.4.2. Any person(s) apprehended during the course of a serious security breach shall be detained until the Police arrive (note: employees are not to put themselves at undue risk by attempting to apprehend or restrain a potentially violent person).

## **6.5 BOMB THREAT**

- 6.5.1. The safety of employees and the public is of primary concern. A person receiving a bomb threat over the telephone should attempt to remain calm and keep the caller talking by asking the questions listed in Table 6-6 (ERP pg. 20). Recording (writing) as much information about the caller and their comments is also very important for future reference. If possible, alert a co-worker to the situation while talking to the caller.
- 6.5.2. The police / mine security should be advised of the bomb threat as soon as possible. Unless there is good reason to the contrary, all personnel should evacuate the Work Site and await the arrival of the police / first responders at the designated meeting area. Suspicious objects should be reported but not tampered with and other people should be prevented from entering the Work Site until the local authority has authorized a return to the Work Site. Employees should be prepared to assist local authorities in their search / inspection of the Work Site as necessary.

**Table 6 - 6**  
***CONVERSATION GUIDELINES IN THE EVENT OF RECEIVING***  
***A BOMB THREAT***  
***See Appendix 7***

## **6.6 LINES OF AUTHORITY**

- 6.6.1 Based upon the information available at the time of the incident, the Work Site Supervisor/Manager, in consultation with others (such as DNCI Senior Management, Mine/local authorities and/or Dyno Nobel advisors), will evaluate the incident and proceed with appropriate steps to implement this ERP. A decision on when to return to the scene of a serious incident will be made in like fashion, subject to approval by public authorities overseeing the incident.
- 6.6.2 The Work Site Supervisor/Manager will have overall responsibility for the implementation of this ERP and the supervision of all Company activities. Public authorities and the site owner have ultimate authority regarding the resumption of normal production activities.

## 7.0 NOTIFICATION AND REPORTING

- 7.1 Any incident that activates this ERP shall be documented on the DYNO Incident (Cintellate) Report. The Corporate Emergency Response Advisor must also be notified and in turn will advise the:

HSE Manager  
Area Manager

Vice President Operations

It is the responsibility of the HSE Manager or his delegate to report the incident to DYNO's HSE Management Team. A major incident involving a fire with emissions and/or a hazardous material spill shall be reported to a provincial Environment Officer under the direction of the Environmental Manager. Major incidents shall also be reported to the Chief Inspector, Explosives Branch, Natural Resources Canada; a Provincial/Territorial Safety Officer; and as applicable, an Emergency Measures Official.

Any incident which involves a spill at a Mine Site shall be immediately reported to the Mine Site Environmental Representative, and followed up with a copy of the incident report when complete.

## 7.2 Spills and Releases – Reportable and Significant Classifications

### 1) Determine if the spill/release is reportable

All environmental incidents are to be input into Cintellate. Reportable spills/releases are not only input into Cintellate, but the investigation and corrective action sections of Cintellate must be completed. To assist in determining if a spill/release is reportable, a listing of common materials with assigned reportable quantities is referenced (see Appendix 5, Reportable Substance List). The reportable quantities utilize the most stringent "reportable quantity" in Canada. Even if the spill/released material is recovered, the media impacted by the spill/release may be reportable to authorities (e.g., a portion of a spill reaching a source of drinking water or wetland). In addition, a spill/release is reportable if the amount equals or exceeds the Dyno Nobel Default Threshold.

### 2) Determine if the spill/release is significant

- Significant spills/releases are disclosed in the company's annual report. Significant spills/releases trigger time-critical internal actions as required by the company's procedures (crisis communication, internal investigation, etc)

The following table is provided to assist in making these determinations:

## Reporting of Environmental Spills

### Is the spill reportable?

- Yes if above a Reportable Quantity
- Yes if oil sheen is visible or sludge/emulsion is deposited beneath water surface
- Yes if water quality standards are exceeded
- Yes if from a UST exceeding 25 gallons or result in a sheen

### Is the spill significant?

- Yes if authorities implement a national contingency plan
- Yes if "sensitive" environmental features have been impacted
- Yes if neighbors are evacuated
- Yes if authorities and/or neighbors file complaints and/or demand response activities
- Yes if financial impact is >US\$100K
- Yes if media coverage is adverse.

### 7.3 Internal investigation reports will include:

- Name, work address, and phone number of the investigating (reporting) individual
- Identification and quantity of the released substance
- Time, duration, and location of the release
- Nature and quantity of injuries, property damage, production loss, administrative penalty and/or legal liability
- Precautions taken during the incident
- Relevant environmental conditions
- Corrective actions taken at the time of the incident
- Recommended corrective actions to prevent future occurrence

### 7.4 Senior Management shall be immediately informed by telephone of any major incident that requires Government notification as per Dyno Nobel's reporting procedures.

### 7.5 Major incidents involving explosive material shall also be reported to the Chief Inspector, Explosives Branch, and Natural Resources Canada by the applicable Regulatory Affairs Coordinator.

**Table 7 - 1**  
**REPORTABLE SUBSTANCE QUANTITY LIST**

Material Released	Reportable to Authorities		Dyno Nobel Default Threshold (Proposed)
	If Recovered	If Unrecoverable/ Abandoned / Disposed	
AN Solution	Not Reportable if it can be used as a product	45 Kg (100 lbs) as released oxidizer (not media specific)	225 Kg (500 lbs)
	44 Kg (100 lbs) for ammonia if released into water	45 Kg (100 lbs) for ammonia if released into water	
	Report if released to Drinking Water (DW std at 10mg/L-N)	Report if released to Drinking Water (DW std at 10mg/L-N)	
	Report if released to aquatic ecosystem (NH3 toxic to fish)	Report if released to aquatic ecosystem (NH3 toxic to fish)	
AN Prill	Not Reportable if it can be used as a product	45 Kg (100 lbs) as released oxidizer (not media specific)	225 Kg (500 lbs)
	45 Kg (100 lbs) for ammonia if released into water	45 Kg (100 lbs) for ammonia if released into water	
	Report if released to Drinking Water (DW std at 10mg/L-N)	Report if released to Drinking Water (DW std at 10mg/L-N)	
	Report if released to aquatic ecosystem (NH3 toxic to fish)	Report if released to aquatic ecosystem (NH3 toxic to fish)	
SN Prill	Not Reportable if it can be used as a product	45 Kg (100 lbs) as released oxidizer (not media specific)	225 Kg (500 lbs)
	Report if released to Drinking Water (DW std at 10mg/L-N)	Report if released to Drinking Water (DW std at 10mg/L-N)	
Acetic Acid	453 Kg (1,000 lbs)	454 Kg (1,000 lbs)	225 Kg (500 lbs)
	Report if released to Drinking Water (DW std at 10mg/L-N)	Report if released to Drinking Water (DW std at 10mg/L-N)	
Sodium Nitrite	45 Kg (100 lbs)	45 Kg (100 lbs)	225 Kg (500 lbs)
	Report if released to Drinking Water (DW std at 1mg/L-N)	Report if released to Drinking Water (DW std at 1mg/L-N)	
Fuel Oil	Reportable if sheen on surface of pond, stream, etc. or sludge within such	Reportable if sheen on surface of pond, stream, etc. or sludge within such	225 Kg (500 lbs); 261 L (69 gallons)
	State Regulations - Varies from Any Amount to specific Trigger Amounts	State Regulations - Varies from All Spills to specific Trigger Amounts	
	95 L (25 gallons) from UST	96 L (25 gallons) from UST	
Mineral Oil	Reportable if sheen on surface of pond, stream, etc. or sludge within such	Reportable if sheen on surface of pond, stream, etc. or sludge within such	225 Kg (500 lbs); 261 L (69 gallons)

	State Regulations - Varies from Any Amount to specific Trigger Amounts	State Regulations - Varies from All Spills to specific Trigger Amounts	
	95 L (25 gallons) from UST	96 L (25 gallons) from UST	
Emulsifier Agents	Reportable if sheen on surface of pond, stream, etc. or sludge within such State Regulations - Varies from Any Amount to specific Trigger Amounts	Reportable if sheen on surface of pond, stream, etc. or sludge within such State Regulations - Varies from All Spills to specific Trigger Amounts	225 Kg (500 lbs); 261 L (69 gallons)
Granular Aluminum	Not Reportable	Not Reportable	225 Kg (500 lbs)
ANFO	Not Reportable if it can be used as a product 45 Kg (100 lbs) for ammonia if released into water Report if released to Drinking Water (DW std at 10mg/L-N) Report if released to aquatic ecosystem (NH3 toxic to fish) Reportable if sheen on surface of pond, stream, etc.	45 Kg (100 lbs) as released oxidizer (not media specific) 45 Kg (100 lbs) for ammonia if released into water Report if released to Drinking Water (DW std at 10mg/L-N) Report if released to aquatic ecosystem (NH3 toxic to fish) Reportable if sheen on surface of pond, stream, etc.	225 Kg (500 lbs)
Emulsion	Not Reportable if it can be used as a product 44 Kg (100 lbs) for ammonia if released into water Report if released to Drinking Water (DW std at 10mg/L-N) Report if released to aquatic ecosystem (NH3 toxic to fish) Reportable if sheen on surface of pond, stream, etc. or sludge within such	45 Kg (100 lbs) as released oxidizer (not media specific) 45 Kg (100 lbs) for ammonia if released into water Report if released to Drinking Water (DW std at 10mg/L-N) Report if released to aquatic ecosystem (NH3 toxic to fish) Reportable if sheen on surface of pond, stream, etc. or sludge within such	225 Kg (500 lbs)
Ethylene Glycol	2250 Kg (5000 lbs)	2250 Kg (5000 lbs)	225 Kg (500 lbs)
Sodium Thiocyanate	45 Kg (100 lbs) Report if released to Drinking Water (DW std at 1mg/L-N)	45 Kg (100 lbs) Report if released to Drinking Water (DW std at 1mg/L-N)	225 Kg (500 lbs)

## 8.0 DECONTAMINATION

- 8.1 DNCI's Standard Operating Procedures and safety rules establish work practices that minimize employees' direct and indirect contact with hazardous substances.
- 8.2 Equipment, rubber boots, gloves and clothes that have been contaminated can be washed with soap and water. Wash water should be collected and disposed of in an approved manner with other contaminated material.

## 9.0 WORKSITE CLOSURE / SHUT DOWN

### 9.1 Plant Shutdown (use appropriate lock-out/tag-out procedures)

- In the event that a plant is shut down due to weather, flood, or other adverse situation, the Plant Manager / Supervisor or his delegate will ensure that all non-essential power is shut off. The Plant Manager / Supervisor will secure all valves and flow devices so as to prevent accidental opening.
- The Plant Manager / Supervisor shall determine if any raw material or raw material storage will be contaminated or at risk of fire/explosion, and take steps to move the material or isolate it from the contamination / hazard source.
- If the power and/or gas will create a dangerous situation the Plant Manager / Supervisor will cut the outside supply of power, thereby isolating all plant equipment.
- The Plant Manager / Supervisor will advise local Mine authorities of the plant shutdown and preventative actions taken.
- All sensitive documents must be secured.

### 9.2 Magazine Closure (use appropriate lock-out/tag-out procedures)

- In the event that a magazine is closed due to weather, flood, or other adverse situation, the Supervisor/Manager or his delegate will ensure that all non-essential power is shut off. Also, the Supervisor/Manager will ensure that all magazines and compound gates are locked before leaving the site.
- The Supervisor/Manager shall determine if any products or raw materials will be contaminated and take steps to move the material or isolate it from the contamination source.
- If power and/or gas will create a dangerous situation the Supervisor/Manager will cut the outside supply of power, thereby isolating all magazine equipment.



## 10. **RESPONSE TO NATURAL DISASTER**

Hurricanes, tornadoes, floods, slides, forest fires, and earthquakes, have the ability to damage or destroy everything in their path. Yet much of the damage or destruction associated with such phenomena is the result of some secondary event, e.g. fallen power lines, ruptured tanks valves, pipes etc. If reasonable warning of an approaching disaster is received, efforts can be made to minimize damage by taking specific preventative measures. These measures are outlined in the following procedures.

1. Consult the Site Supervisor for guidance and proceed according to his direction. **SEE SITE SPECIFIC POTENTIAL HAZARDS APPENDIX 10**
2. If so directed, notify key personnel regarding the action being taken.
3. Collect important files, records and papers for safekeeping.
4. Open main electrical breaker to cut off all power to the site. (The main breaker is marked for easy identification).
5. Secure all buildings and equipment and lock the site gate.
6. Evacuate the site taking mobile equipment to safety.
7. Post Guards on site access routes to monitor the activities of unauthorized personnel.
8. A report of the incident must be submitted to the Area Manager within 24 hours.

### 10.1 **PREVENTIVE MEASURES**

#### 10.2 **Waste Disposal Permits**

If nitrate waste is generated, a disposal permit must be obtained and kept up to date if the product will be disposed of off-site, or in mine tailings. Permits to dispose of other collected waste in the event of spills or leaks (such as described in Section 6.3) must also be obtained in consultation with mine / provincial environmental representatives

#### 10.3 **Liquid Containment**

All fuel / oil storage tanks must be dyked according to the provisions of Federal and/or Provincial regulations (eg. National Fire Code, Environmental Protection Act), or have a double-walled tank.

A plan must be in place and materials on hand to create a dyke in the event of a large fuel or solution leak or spill or other emergency spill situation.

#### 10.4 **Inspection**

All site emergency storage areas and equipment must be inspected monthly by qualified personnel, monthly for physical condition and serviceability,



and the results recorded according to quality and safety standard operating procedures.

All recommendations/orders made by NRC Explosives Branch inspectors, Fire Marshals and insurance inspectors must be responded to and acted upon accordingly. Copies of their reports are to be forwarded to DNCI's HSE representative for the region.

**10.5 Maintenance**

All preventive and breakdown maintenance must be carried out and recorded in accordance with standard operating procedures.

**11.0 WORK SITE START UP  
(Restoration of Business)**

- 11.1 Before startup, the condition prompting the shutdown / closure must be over / corrected (i.e. flood, fire, explosion or blizzard).
- 11.2 All decontamination procedures must be followed and the site cleared and cleaned of any environmental waste hazards.
- 11.3 All repairs to plant equipment involving safety shutdowns and essential operating machinery must be completed.
- 11.4 All electrical circuits, plumbing and piping must be tested.
- 11.5 The Work Site Supervisor / Manager will ensure that all lockout and tag-out procedures have been followed and signed off.
- 11.6 The Work Site Supervisor / Manager will start up the facility by turning on individual switches to the components that have been shutdown.
- 11.7 Operational checks will be done to ensure that all equipment is functioning at safe working pressures and voltage.
- 11.8 The Work Site Supervisor / Manager will give the verbal "all clear" before workers will be allowed to return to work.
- 11.9 The Work Site Supervisor / Manager or one of their delegates will cancel / remove all roadblocks, terminate evacuation activities, and notify employees to return to normal activities.

## APPENDIX 1

<b>Basic Investigation Report</b> (Factual Report not prepared Under Legal Professional Privilege)		
<b>Incident Title</b>		
	<b>Incident No.</b>	
	<b>Incident Date</b>	
	<b>Site</b>	
	<b>Department / Location</b>	
	<b>Report Author</b>	
	<b>Report Date</b>	
	<b>Investigation Manager</b>	
	<b>Investigation Team Members</b>	
	<b>Report Distribution</b>	
<b>Who was involved?</b> name, job, title		
<b>When did it happen?</b> date & exact time		
<b>Where did it happen?</b> The exact location		
<b>What was the person doing at the time?</b> What product or equipment was involved		
<b>What went wrong?</b> Not your opinion, only factual information. Eg: an operator fell off a ladder, the hose broke; spill / quantity		
<b>What happened?</b> Describe the sequence and timing of events		
<b>Immediate Control Actions</b> What first aid treatment was given and or actions taken (valve turned off, electricity isolated) immediately after the incident to make the situation safe		
<b>Interim Control Action</b> The interim corrective actions to prevent re-occurrence		
<b>5-Why Analysis - Consolidate the information above into a flow chart</b> Double click on chart to enter visio and update as required		
<b>Contributing factors</b> What factors combined to make the situation unsafe – in descending order of importance		
<b>Root Cause</b> What were the root causes identified in the 5Why analysis – in descending order of importance		
<b>Corrective Action</b>	<b>Who</b>	<b>Due Date</b>
<b>Comments</b>		

## APPENDIX 2

### DNCI Corporate contact

Name	Position	Cell number
Benoit Choquette	Environmental Manager - Canada	(514) 246-6285
Seamus Kilcommons	H&S Manager Western Canada	(403) 815-4066
Tim Marles	H&S Advisor Artic	(403) 723-7540
Willard Pierce	Regional Manager West/ Central Canada	(403) 836-9029
Hubert Fafard	H&S Manager Eastern Canada	(418) 570-9257
Greg Brown	Sales Manager Western	(403) 512-5127
Ralph Olson	Operations Manager of Western Canada	(250) 713-8720
Randy Armella	Bulk Operations Manager	(780) 865-6580
Rick Chopp	H&S Manager – Central Canada	(705) 498-2855
Pierre St Georges	Regulatory Affairs Coordinator	(613) 677-1051
Cory Redwood	General Manager Western Canada	(867) 444-8533

### APPENDIX 3

#### DNCI Emergency Response Advisors (ERA) per area

<b>Name</b>	<b>Position</b>	<b>Cell number</b>	<b>Area (West, Central or East)</b>
<b>Tom Medak</b>	<b>Mgr, Bulk operations</b>	<b>(403) 818-4434</b>	<b>West / Arctic</b>
<b>Dennis Wall &amp; Doug Robertson</b>	<b>Meadowbank Operations Supervisors</b>	<b>(867) 793-4610 opt 2 ext 6804 Cell (867) 222-3930</b>	<b>Arctic</b>
<b>Seamus Kilcommons</b>	<b>H&amp;S Manager Western Canda</b>	<b>(403) 815-4066</b>	<b>West</b>
<b>Tim Marles</b>	<b>H&amp;S Advisor Arctic</b>	<b>(403) 723-7540 office</b>	<b>Artic</b>
<b>Tyrone McClean</b>	<b>Operations manager, Manitoba and Saskatchewan</b>	<b>(204) 687-0046</b>	<b>Central</b>
<b>Corey Rachuk</b>	<b>Plant Supervisor - Flin Flon</b>	<b>(204) 687-0028</b>	<b>Central</b>
<b>Joss Forget</b>	<b>Operations Manager Northern Ontario</b>	<b>(705) 471- 8745</b>	<b>East</b>
<b>David Roy</b>	<b>Manager Plant operations</b>	<b>(418) 570-5604</b>	<b>East</b>
<b>Francois Lambert</b>	<b>Operations Manager</b>	<b>(514) 212-3490</b>	<b>East</b>
<b>Daniel Roy</b>	<b>Dyno Consult , Ste-Sophie</b>	<b>(514) 213-5889</b>	<b>East</b>

**APPENDIX 4**  
**SITE: QAAQTUQ / Meadowbank Operations**

**MANAGEMENT AND WORK SITE CONTACT LIST**

NAME	TITLE	BUSINESS PHONE	2 WAY RADIO	CELL PHONE
Dennis Wall	Site Supervisor	(867)793-4610 opt#2 ext 6804		(867) 222-3930
Doug Robertson	Site Supervisor	((867)793-4610 opt#2 ext 6804		(867) 222-3930
Tom Medak	Bulk Manager	(403) 236-9160		(403) 818-4434
Tim Marles	H&S Advisor Arctic	403 723-7540		TBA
Seamus Kilcommons	H&S Manager	(403) 236-9160		(403) 815-4066
Benoit Choquette	Environmental Manager	(450) 818-7176		(514) 249-6285
Pierre St George	Regulatory Affairs Coordinator	(613) 632-5844		(613) 677-1051

**Agnico-Eagle Mines Ltd. – Meadowbank WORK SITE CONTACT LIST**

NAME	TITLE	BUSINESS PHONE	2 WAY RADIO	CELL PHONE
Meadowbank Mine		(867)793-4610		
Julie Belanger	Agnico-Eagle	(867)793-4610 ext 6721		

**EXTERNAL CONTACT NUMBERS**

ORGANIZATION/CONTACT	LOCATION	PHONE NUMBER
NT Oil & Chemical Spills	Iqaluit, NU	(867) 979-8130
Environment Canada, NT	Yellowknife, NT	(867) 669-4700
NRC / Explosives Branch	Ottawa	(613) 995-5555
RCMP	Baker Lake, NU	(867) 793-1111 or (867)-793-0123
RCMP 'G' Division	Yellowknife, NT	(867)669-5100

## APPENDIX 5

**Area Office Address:**

Agnico-Eagle Mines Ltd. - Meadowbank  
PO BOX 540  
Baker Lake, Nunavut  
X0C 0A0

**Type of Facility:**

Bulk Explosives Site

**Customer/Client Information:**

Customer: Agnico-Eagle  
Contact:  
Title:

**Evacuation and Emergency Meeting Place Upon Evacuation:**

As identified on site orientation forms (Designated Muster Points)

**Emergency Shutdown switch location:**

**“ONLY A CERTIFIED PERSONELLE ARE TO ACTIVATE THIS SWITCH”**

**Magazine and Plant Site Address:****NRC License:**

Agnico-Eagle Meadowbank Mine

**Site Plan and Evacuation Route:**

Posted in site offices – site specific orientations required

**Site Rescue Plans:**

Site Supervisor or designate to conduct review of attendance sheet. If employees, visitors or contractors are unaccounted for, Site Supervisor will advise mine LPO of unaccounted persons and last known location. Site Supervisor shall attend last known location with mine rescue team and jointly determine potential hazards of re-entering area to locate unaccounted for persons. Site Supervisor and Rescue team entering the evacuated area must don all required PPE due to unknown potential dangers that may have come about. Proper fire retardant suits, SCBA and/or other PPE as determine by the site to protect rescuers from becoming overcome by physical, chemical or other hazards. If determined safe to enter site and/ or buildings, a counter clockwise sweep of the area is to be conducted.

**Medical Emergencies: In the unlikely event of a medical emergency, the site shall ensure that it is compliant to OH&S Code. As per legislation requirements, the site shall have adequate first aiders and equipment to attend to individuals as required.**

**All incidents, first aid/ medical treatment/property damage/near miss or other, shall be in compliance with HSE MS Standard 9.2, which meets or exceeds legislative requirements.**

<b>Site First Aiders:</b>	<b>LOCATION</b>	<b>PHONE NUMBER</b>
TBA		
Security (Mine Emergency Services –fire, EMS)		

**Emergency Equipment On Hand:**

Fire Extinguishers, Spill Kits, First Aid Kits, non-sparking shovels as outlined in site plan.

**Delivery Vehicles:**

<u>Unit #</u>	<u>Vehicle</u>	<u>(EVC/ETP) TC Permit #</u>	<u>Carrying Capacity (80% of Max.)</u>
---------------	----------------	----------------------------------	--

## APPENDIX 6 BOMB THREAT CHECKLIST

Exact time of call:			
Exact words of caller:			
<b>QUESTIONS TO ASK</b>			
1- When is bomb going to explode?			
2- Where is the bomb?			
3- What does it look like?			
4- What kind of bomb is it?			
5-What will cause it to explode?			
6- Did you place the bomb?			
7- Why?			
8- Where are you calling from?			
9- What is your address?			
10- What is your name?			
<b>CALLER'S VOICE (circle)</b>			
1- Calm	Slow	Crying	Slurred
2- Stutter	Deep	Loud	Broken
3- Giggling	Accent	Angry	Rapid
4- Stressed	Nasal	Lisp	Excited
5- Disguised	Sincere	Squeaky	Normal
If voice is familiar, whom did it sound like?			
Were there any background noises?			
Remarks:			
Person receiving call:		Telephone number call received at:	
Date:		Report call immediately to:	



## APPENDIX 7

### Dyno Nobel Inc.

### JOB-SPECIFIC ORIENTATION CHECKLIST

(Modify as needed to meet site-specific needs)

Employee Name: Job Title:

Location: Hire Date:

CHECK COMPLETED ITEMS. FOR ALL ITEMS THAT ARE NOT APPLICABLE, ENTER "NA" ON THE LINE RETURN COMPLETED AND SIGNED CHECKLIST TO APPROPRIATE HR REPRESENTATIVE

#### 1. JOB SPECIFIC ORIENTATION TO DNA WORK SITE(S)

- |   |   |
|---|---|
| a. <input type="checkbox"/> DN Safety & Quality Policy                  | m. <input type="checkbox"/> Drug and Alcohol Policy             |
| b. <input type="checkbox"/> General Safety Rules                        | n. <input type="checkbox"/> Site Emergency and Evacuation Plans |
| c. <input type="checkbox"/> Site Specific Safety Rules and Instructions | o. <input type="checkbox"/> Fire Extinguishers                  |
| d. <input type="checkbox"/> Products and Services                       | p. <input type="checkbox"/> DN Crisis Communication Plan        |
| e. <input type="checkbox"/> Tour of Site                                | q. <input type="checkbox"/> Parking and Traffic Plan            |
| f. <input type="checkbox"/> Rest Rooms, Lockers, Eating Areas           | r. <input type="checkbox"/> Security Issues                     |
| g. <input type="checkbox"/> Dress and Uniform Standards                 | s. <input type="checkbox"/> Electrical Hazards                  |
| h. <input type="checkbox"/> Personal Protective Equipment               | t. <input type="checkbox"/> Review Job Description              |
| i. <input type="checkbox"/> First Aid Procedures                        | u. <input type="checkbox"/> Take 5 Program                      |
| j. <input type="checkbox"/> How to Report Near-Misses and Accidents     | v. <input type="checkbox"/> Site Specific SOPs                  |
| k. <input type="checkbox"/> Workers' Compensation and Return to Work    |   |
| l. <input type="checkbox"/> Smoking Policy and Designated Areas         |   |

#### 2. OCCUPATIONAL HEALTH AND SAFETY ACT - REGULATION (OHSA)

- |  |  |
|--|--|
| a. <input type="checkbox"/> Mobile Equipment (Forklifts/Bobcats) | e. <input type="checkbox"/> DNA Hearing Conservation |
| b. <input type="checkbox"/> Review Site MSDS                     | f. <input type="checkbox"/> Bloodborne Pathogens     |
| c. <input type="checkbox"/> Confined Spaces                      | g. <input type="checkbox"/> Worker's Rights          |
| d. <input type="checkbox"/> Lockout/Tagout                       |  |

#### 3. ENVIRONMENT CANADA

- |   |   |
|---|---|
| a. <input type="checkbox"/> Spill/Release Reporting                 | d. <input type="checkbox"/> Used Oil Management       |
| b. <input type="checkbox"/> Proper disposal of Waste                | e. <input type="checkbox"/> Drum/Container Management |
| c. <input type="checkbox"/> Waste Minimization/Pollution Prevention |   |

#### 4. TRANSPORTATION CANADA (TDG)

- |  |   |
|--|---|
| a. <input type="checkbox"/> Road Test          | c. <input type="checkbox"/> TDG Hours of Service Policy |
| b. <input type="checkbox"/> TDG Transportation | d. <input type="checkbox"/> Pre and Post Inspections    |

#### 5. NATURAL RESOURCES CANADA, EXPLOSIVES SAFETY AND SECURITY BRANCH

- |  |  |
|--|--|
| a. <input type="checkbox"/> Site Security Plans / Key Policy | b. <input type="checkbox"/> Magazine Rules                           |
| c. <input type="checkbox"/> Inventory Accuracy               | d. <input type="checkbox"/> Guidelines for bulk explosive facilities |

#### 6. QUESTIONS AND SUMMARY

—

—

— Ask employee if there are any questions or areas of employment not clearly understood. Advise employee what's next.

Comments

:

\_\_\_\_\_  
Signature Date Trainer/Supervisor Signature \_\_\_\_\_ Date \_\_\_\_\_ Employee

APPENDIX 8

**ANNUAL FIRE DEPARTMENT REVIEW FORM**

**Information to be released to Emergency Services**

**From: Local Emergency Services**

**Subject: Emergency Response Plan for \_\_\_\_\_.**

**The following is a copy of the Emergency Response Plan that has been prepared by Dyno Nobel Inc. Has been received from \_\_\_\_\_ operations. The ERP has been discussed and being kept on file for future reference. If questions arise, we have been given the contact information for the \_\_\_\_\_ operations staff.**

**Signed:\_\_\_\_\_**

**Position:\_\_\_\_\_**

**Date:\_\_\_\_\_**

**EMERGENCY RESPONSE REPORT/DEBRIEF TEMPLATE (found in NEXUS Std 9.1)**

**Site:** .....

**Date:** .....

**Drill or**

**Actual Event** (circle)

**Emergency Call placed with:**

Mine Emergency ☐

911 ☐

**Supervisor/Manager Advised:** ☐

**Incident Details:**

# Sequence of Events

Time	Activity	By

**Gaps Identified:**

	Details of Gaps Identified	*Action Required
1.		
2.		
3.		
4.		
5.		
6.		
7.		
8.		

**A report should be raised in SHAERS/ICARUS listing all gaps identified and action required.**

**Fax completed form to Health & Safety Advisor for your site**

**APPENDIX 9**  
**Transportation of Dangerous Goods Regulation**  
**Class Quantity Emission Limit**

<b>1</b>	Any quantity that could pose a danger to public safety or 50 kg
<b>2</b>	Any quantity that could pose a danger to public safety or any sustained release of 10 minutes or more
<b>3</b>	200 L
<b>4</b>	25 kg
<b>5.1</b>	50 kg or 50 L
<b>5.2</b>	1 kg or 1 L
<b>6.1</b>	5 kg or 5 L
<b>6.2</b>	Any quantity that could pose a danger to public safety or 1 kg or 1 L
<b>7</b>	Any quantity that could pose a danger to public safety. An emission level greater than the level established in section 20 of the <i>Packaging and Transport of Nuclear Substances Regulations</i>
<b>8</b>	5 kg or 5 L
<b>9</b>	25 kg or 25 L

Table identified in Section 8.1(1) of Part 8 of the Transportation of Dangerous Goods Regulation Class Quantity Emission Limit

## APPENDIX 10

## Emergency Risk Assessment

**Site Emergency Response Plan should be based upon a risk assessment of all types of probable emergencies and regulatory impact (as found in NEXUS Std 9.1)**

Location Date Analysis Completed Completed by:

Emergency Type	Scenario(s)	Safeguards	Historical Frequency	Future Risk Potential	Loss Severity Rate	Probable Emergency 8+ to be in plan	Regulatory Notifications	Actions / Remarks
Bomb Threat								
Chemical Spill/Release								
Security								
Explosion								
Fire								
Loss/Theft of Explosives								
Equipment								
Process Loss/Interruption								
Catastrophic Injury/Illness								
Trespassing/Vandalism								
Extreme Temperatures								
Earthquake								
Hurricane								
Tornado								
Severe Flooding								
OFF SITE								
Blast Site Incident								
Fire (Forest/Brush)								
Neighboring Facility Incident								
Transportation Vehicle Accident								
Transportation Fire/Explosion Incident								
Transportation Chemical Spill								
Transportation Vehicle Breakdown								

## Emergency Assessment Score Information - Use to evaluate Emergency Type level of risk

Historical Frequency	Score	Future Risk Potential	Score	Loss Severity Rate	Score	Probability Total A & B (8+) to be in plan
Several Time per Year	5	Several Time per Year	5	Catastrophic	5	
One Time per Year	4	One Time per Year	4	Major/Critical	4	12 or higher
Once Every 3-5 Years	3	Once Every 3-5 Years	3	Serious	3	8-11
Less than Once Every 10 Yrs	2	Less than Once Every 10 Yrs	2	Negligible- No Loss	2	Less and 8
Very Unlikely to Happen Ever	1	Very Unlikely to Happen Ever	1	No Loss Occurrence	1	

## **APPENDIX 4**

### **MSDS FOR BULK EMULATION AND PRESPLIT**

- 1. MSDS – Dyno Gold Lite Bulk Emulsion**
- 2. MSDS – Detagel Presplit**

# Material Safety Data Sheet

**Dyno Nobel Inc.**

2650 Decker Lake Boulevard, Suite 300

Salt Lake City, Utah 84119

Phone: 801-364-4800 Fax: 801-321-6703

E-Mail: dnna.hse@am.dynonobel.com

**FOR 24 HOUR EMERGENCY, CALL** **CHEMTREC (USA) 800-424-9300**  
**CANUTEC (CANADA) 613-996-6666****MSDS # 1052****Date** 10/20/05

Supersedes

MSDS # 1052 03/21/05

Added Dyno® RG3

## SECTION I - PRODUCT IDENTIFICATION

**Trade Name(s):** DYNOL GOLD® C, DYNOL GOLD® C EXTRA  
DYNOL GOLD® C LITE, DYNOL GOLD® C LITE SUPER  
DYNOL GOLD® CS LITE  
DYNOL GOLD®, DYNOL GOLD® LITE  
DYNOL GOLD® B, DYNOL GOLD® B LITE  
HD  
1116, 1126P, 1136P, 1146P  
IREMEX 362, IREMEX 562, IREMEX 762, IREMEX 764  
RJ5  
RG1-A  
RUG-1 (Canada Only)  
DX 5007; DX 5010  
DX 5013; DX 5013G; DX 5013 PB  
TITAN® XL1000  
TITAN® 1000, TITAN® 1000 G, TITAN® PB 1000  
DYNOL® RG3

**Product Class:** Bulk Emulsion**Product Appearance & Odor:** Translucent to opaque, viscous liquid. May be silvery in color. May have fuel odor.

**DOT Hazard Shipping Description:** As Transported:  
Oxidizing Liquid, n.o.s. (Ammonium Nitrate) 5.1 UN3139 II  
After Blending with Density Control Agent On-site:  
Explosive, Blasting, Type E 1.5D UN0332 II

**NFPA Hazard Classification:** Not Applicable (See Section IV - Special Fire Fighting Procedures)

## SECTION II - HAZARDOUS INGREDIENTS

Ingredients:	CAS#	% (Range)	ACGIH TLV-TWA
Ammonium Nitrate	6484-52-2	30-80	No Value Established
Sodium Nitrate <sup>1</sup>	7631-99-4	0-15	No Value Established
Calcium Nitrate	10124-37-5	0-35	No Value Established
Fuel Oil	68476-34-6	0-10	100 ppm
Mineral Oil	64742-35-4	0-7	5 mg/m <sup>3</sup>
Aluminum *	7429-90-5	0-5	10 mg/m <sup>3</sup>



# Material Safety Data Sheet

<sup>1</sup> Our source of Sodium Nitrate (Chilean) may contain perchlorate ion, which occurs naturally. Although Dyno Nobel does not analyze for the presence of perchlorate anion, based on published studies, the products listed above may contain between 0 and 300 ppm perchlorate.

\* The hazardous ingredients marked with an asterisk are not found in the majority of listed products.

Ingredients, other than those mentioned above, as used in this product are not hazardous as defined under current Department of Labor regulations, or are present in de minimus concentrations (less than 0.1% for carcinogens, less than 1.0% for other hazardous materials).

## SECTION III - PHYSICAL DATA

**Boiling Point:** Not Applicable

**Vapor Density:** (Air = 1) Not Applicable

**Percent Volatile by Volume:** <30

**Vapor Pressure:** Not Applicable

**Density:** 0.8 - 1.5 g/cc

**Solubility in Water:** Nitrate salts are completely soluble, but emulsion dissolution is very slow.

**Evaporation Rate (Butyl Acetate = 1):** <1

## SECTION IV - FIRE AND EXPLOSION HAZARD DATA

**Flash Point:** Not Applicable

**Flammable Limits:** Not Applicable

**Extinguishing Media:** (See Special Fire Fighting Procedures Section)

**Special Fire Fighting Procedures:** Do not attempt to fight fires involving explosive materials or emulsion explosive precursors. Evacuate all personnel to a predetermined safe location, no less than 2,500 feet in all directions.

**Unusual Fire and Explosion Hazards:** May explode or detonate under fire conditions. Burning material may produce toxic vapors.

## SECTION V - HEALTH HAZARD DATA

### Effects of Overexposure

**Eyes:** Can cause irritation, redness and tearing.

**Skin:** Prolonged contact may cause irritation.

**Ingestion:** Large amounts may be harmful if swallowed.

**Inhalation:** May cause dizziness, nausea or intestinal upset.

**Systemic or Other Effects:** *Perchlorate:* Perchlorate can potentially inhibit iodide uptake by the thyroid and result in a decrease in thyroid hormone. The National Academy of Sciences (NAS) has reviewed the toxicity of perchlorate and has concluded that even the most sensitive populations could ingest up to 0.7 microgram perchlorate per kilogram of body weight per day without adversely affecting health. The USEPA must establish a maximum contaminant level (MCL) for perchlorate in drinking water by 2007, and this study by NAS may result in a recommendation of about 20 ppb for the MCL.

### Emergency and First Aid Procedures

**Eyes:** Irrigate with running water for at least fifteen minutes. If irritation persists, seek medical attention.

**Skin:** Remove contaminated clothing. Wash with soap and water.

**Ingestion:** Seek medical attention.

**Inhalation:** Remove to fresh air. If irritation persists, seek medical attention.

**Special Considerations:** None.



# Material Safety Data Sheet

## SECTION VI - REACTIVITY DATA

**Stability:** Stable under normal conditions. May explode when subjected to fire, supersonic shock or high-energy projectile impact, especially when confined or in large quantities.

**Conditions to Avoid:** Keep away from heat, flame, ignition sources and strong shock.

**Materials to Avoid (Incompatibility):** Corrosives (strong acids and strong bases or alkalis).

**Hazardous Decomposition Products:** Nitrogen Oxides (NO<sub>x</sub>), Carbon Monoxide (CO)

**Hazardous Polymerization:** Will not occur.

## SECTION VII - SPILL OR LEAK PROCEDURES

**Steps to be taken In Case Material is Released or Spilled:** Protect from all ignition sources. In case of fire evacuate area not less than 2,500 feet in all directions. Notify authorities in accordance with emergency response procedures. Only personnel trained in emergency response should respond. If no fire danger is present, and product is undamaged and/or uncontaminated, repackage product in original packaging or other clean DOT approved container. Ensure that a complete account of product has been made and is verified. Follow applicable Federal, State and local spill reporting requirements.

**Waste Disposal Method:** Disposal must comply with Federal, State and local regulations. If product becomes a waste, it is potentially regulated as a hazardous waste as defined under the Resource Conservation and Recovery Act (RCRA) 40 CFR, part 261. Review disposal requirements with a person knowledgeable with applicable environmental law (RCRA) before disposing of any explosive material.

## SECTION VIII - SPECIAL PROTECTION INFORMATION

**Ventilation:** Not required for normal handling.

**Respiratory Protection:** None normally required.

**Protective Clothing:** Gloves and work clothing that reduce skin contact are suggested.

**Eye Protection:** Safety glasses are recommended.

**Other Precautions Required:** None.

## SECTION IX - SPECIAL PRECAUTIONS

**Precautions to be taken in handling and storage:** Store in cool, dry, well-ventilated location. Store in compliance with Federal, State and local regulations. Keep away from heat, flame, ignition sources and strong shock.

**Precautions to be taken during use:** Avoid breathing the fumes or gases from detonation of explosives. Use accepted safe industry practices when using explosive materials. Unintended detonation of explosives or explosive devices can cause serious injury or death.

**Other Precautions:** It is recommended that users of explosives material be familiar with the Institute of Makers of Explosives Safety Library publications.

## SECTION X - SPECIAL INFORMATION

The reporting requirements of Section 313 of Title III of the Superfund Amendments and Reauthorization Act of 1986 and 40 CFR 372 may become applicable if the physical state of this product is changed to an aqueous solution. If an aqueous solution of this product is manufactured, processed, or otherwise used, the nitrate compounds category and ammonia listings of the previously referenced regulation should be reviewed.

# Material Safety Data Sheet

## Disclaimer

Dyno Nobel Inc. and its subsidiaries disclaim any warranties with respect to this product, the safety or suitability thereof, the information contained herein, or the results to be obtained, whether express or implied, INCLUDING WITHOUT LIMITATION, ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE AND/OR OTHER WARRANTY. The information contained herein is provided for reference purposes only and is intended only for persons having relevant technical skills. Because conditions and manner of use are outside of our control, the user is responsible for determining the conditions of safe use of the product. Buyers and users assume all risk, responsibility and liability whatsoever from any and all injuries (including death), losses, or damages to persons or property arising from the use of this product or information. Under no circumstances shall either Dyno Nobel Inc. or any of its subsidiaries be liable for special, consequential or incidental damages or for anticipated loss of profits.

# Detagel Presplit

## Material Safety Data Sheet

5700 N. Portland, Suite 301 / Oklahoma City, OK 73112 / Phone: (405) 947-0765 / Fax: (405) 947-0768

SECTION 1 - PRODUCT INFORMATION		SECTION 2 - HEALTH ALERT
TRADE NAME:	Presplit	DANGER - If misused or disposed of improperly, material could explode and cause death or serious injury. <b>DO NOT HANDLE WHEN IN DOUBT!!</b> **See section VIII - Personal Protection** CHEM-TEL, INC. (800) 255-3924.
SYNONYM:	NA	
CHEMICAL FAMILY:	Watergel Slurry High Explosive	
FORMULA:	Mixture	
CAS NUMBER:	None	
UN/NA NUMBER:	UN0241	
DOT HAZARD CLASS:	Explosive, Blasting, Type E, Class 1.1 D	

### SECTION 3 - HEALTH HAZARD INFORMATION

**EYE:** May cause moderate irritation.

**SKIN:** May cause moderate irritation characterized by redness and/or rash.

**INHALATION:** Inhalation of decomposed products may irritate the respiratory tract. Prolonged exposure to these fumes may result in respiratory difficulties (shortness of breath, etc.) and possibly more severe toxic effects.

**INGESTION:** Swallowing large quantities may cause toxicity characterized by dizziness, bluish skin coloration, methemoglobinemia, unconsciousness, abdominal spasms, nausea, and pain.

### SECTION 4 - EMERGENCY AND FIRST AID PROCEDURES

**EYE CONTACT:** Flush with large amounts of water. Seek medical aid.

**SKIN CONTACT:** Remove contaminated clothing. Wash skin thoroughly with soap and water.

**INHALATION:** Remove from exposure. If breathing stops or is difficult, administer artificial respiration or oxygen. Seek medical aid.

**INGESTION:** Give 8-16 oz. of milk or water. Induce vomiting. Seek medical aid.

### SECTION 5 - RECOMMENDED OCCUPATIONAL EXPOSURE LIMIT/ HAZARDOUS INGREDIENTS

EXPOSURE LIMIT (PRODUCT): None required for product. \*React to form Hexaminedinitrate

HAZARDOUS INGREDIENTS:	PERCENT	EXPOSURE LIMIT	PPM	MG/M3
Ammonium Nitrate	<65%	NONE		
Sodium Nitrate	<20%	NONE		
Sodium Perchlorate	<7%	NONE		
Nitric Acid*	<5%	ACGIH - TLV	2	5
Hexamine*	<15%	NONE		
Aluminum	<7%	ACGIH - TLV		
Pentaerythritol Tetranitrate	<2%	NONE		

NOTE: All ingredients are present in a gelled slurry matrix and individual hazard may not be present in this formulation.

### SECTION 6 - REACTIVITY DATA

**CONDITIONS CONTRIBUTING TO INSTABILITY:** Heat (confinement); Stacking (burning).

**INCOMPATIBILITY:** Can react violently or explode, with reducing agents and organic materials. Avoid amines, strong alkalis & acids. **HAZARDOUS REACTION / DECOMPOSITION PRODUCTS:** At high temperatures, especially >374 F, may emit severe toxic fumes of nitrogen oxides.

**CONDITIONS CONTRIBUTING TO HAZARDOUS POLYMERIZATION:** Not applicable.

### SECTION 7 - FIRE AND EXPLOSION HAZARD INFORMATION

**FLASH POINT & METHOD:** NA **AUTO IGNITION TEMPERATURE:** Explodes **FLAMMABLE LIMITS ( % BY VOLUME/AIR):**

**LOWER:** NA **UPPER:** NA **EXTINGUISHING MEDIA:** Water **FIRE-FIGHTING PROCEDURES:** When explosive is burning,

**EVACUATE AREA.** Avoid breathing vapor. Don't disturb fire, as dusty cloud containing aluminum may form explosive mixture with air.

**FIRE & EXPLOSION HAZARDS:** Dangerous when exposed to heat or flame. Can support combustion of other materials involved in a fire and is capable of undergoing detonation if heated to high temperatures, especially under confinement including being piled on itself in a burning fire. When heated to decomposition, highly toxic fumes may be emitted. Do not return to area of explosion until smoke and fumes have dissipated. Dry alkali or amine salts are explosive.

# Detagel Presplit

## Material Safety Data Sheet

### SECTION 7 - FIRE AND EXPLOSION HAZARD INFORMATION (con't.)

Internally, product contains detonating cord, consisting of flexible cord with an explosive core of PETN (pentaerythritol tetranitrate) within a textile casing covered by a seamless polyethylene jacket. This portion, if removed from the cartridge, may explode when subjected to fire or shock. PETN crystals, if separated or spilled, are substantially more sensitive to initiation by impact and friction than other components of the product, and care should be taken to avoid shock, friction, and excessive heat.

### SECTION 8 - PERSONAL PROTECTION INFORMATION

**EYE PROTECTION:** Safety goggles approved for the handling of explosives materials.

**SKIN PROTECTION:** Neoprene, natural rubber, polyethylene or polyvinyl chloride gloves. Use barrier creams, hand protection and protective clothing. **RESPIRATORY PROTECTION:** Not normally required. Mechanical filter or supplied air type respirator as required for concentrations exceeding the occupational exposure limit.

**VENTILATION:** Maintain adequate ventilation. Use local exhaust if needed.

### SECTION 9 - PERSONAL HANDLING INSTRUCTIONS

**HANDLING:** Explosives should not be abandoned at any location for any reason. Do not handle during electrical storms.

**STORAGE:** Store in a cool, dry, well-ventilated area remote from operations. Storage area should be of non-combustible construction and in accordance with appropriate BATF regulations. Organic materials, flammable substances and finely divided metals should be stored separately. Flames, smoking and unauthorized personnel are prohibited where this product is used or stored. Protect against physical damage, static electricity and lightning.

**WARNING:** Use of this product by persons lacking adequate training, experience and supervision may result in death or serious injury. Obey all Federal, State, and local laws / regulations applicable to transportation, storage, handling, and use of explosives.

**DISTANCE:** Always stay from area of explosion or disposal sites. Stay behind suitable barriers.

### SECTION 10 - SPILL & LEAK PROCEDURES

**PROCEDURES IF MATERIAL IS RELEASED OR SPILLED (IN ADDITION, SEE SECTION 8):** Isolate area. Eliminate ALL sources of ignition. Avoid skin contact. Scrape up. Remove soiled clothing.

**WASTE DISPOSAL - USE APPROPRIATE METHOD(S):** Disposal of unexploded or deteriorated explosives material can be hazardous. Expert assistance is positively recommended in destroying explosives. Accidents can be prevented by thorough planning and handling in accordance with approved methods. Consult your supervisor, or the nearest SEC Regional Office for assistance. If improperly disposed of, material could explode and cause death or serious injury.

In all cases, follow facility emergency response procedures. Contact Facility Environmental Manager for assistance. Report any discharge of oil or hazardous substance that may enter surface waters to the National Response Center (800) 424 - 8802.

Observe all applicable local, state, and federal environmental spill and water quality regulations.

### SECTION 11 - PHYSICAL DATA

**BOILING POINT:** NA **BULK DENSITY:** 1.25 g/cc **MELTING POINT:** NA **%VOLATILE BY VOLUME:** NA  
**VAPOR PRESSURE:** NA **EVAPORATION RATE (ETHER=1):** NA **SOLUBILITY IN WATER:** Negligible with short term exposure  
**APPEARANCE/ODOR:** Odorless .gray/white gel packaged in polyethylene cartridges **DECOMPOSITION POINT:** 200 C

### SECTION 12 - COMMENTS

This product is classified as a Class 1.1D High Explosive and must be stored in a high explosive magazine. Storage should be in a well constructed, well ventilated, dry structure located to conform with local, state, and federal regulations. The area surrounding an explosive magazine must be kept clear of combustible materials for a distance of 50 feet. Magazine floors and containers must be properly cleaned. Normal operating conditions are assumed unless otherwise stated. If any given information is not clear or does not apply to your situation, STOP, store the material suitably, and seek correct help from your supervisors, Institute of Makers of Explosives or Slurry Explosive Corporation.

Disposal sites must be clear of people at the time of disposal.

**NOTICE:** The data and recommendations presented herein are based upon data which are considered to be accurate. However, SEC makes no guarantee or warranty, either expressed or implied, of the accuracy or completeness of these data and recommendations. For more detailed information on the hazards of this product, contact the Regulatory Compliance Department at the address below:

Slurry Explosive Corporation  
P. O. Box 348  
Columbus, Kansas 66725  
(620) 597-2552

Revised 6-2001

## **APPENDIX 5**

### **EMULSION PLAN / BLAST AREA INSPECTION SHEET**



# Agnico-Eagle Mines: Meadowbank Division

## Environment Department



### Environmental Inspection Report for the Emulsion Plant Area and the Loading of Blast Holes

**Date:**

**Inspected By:**

**Location:** Emulsion Plant

### Weekly Inspection

In Compliance with	Subject	Conform	Non-conform	N/A	Comments
NWB Part B Item 15	Sign posted to inform of a waste disposal facility				
NWB Part D Item 29 MBK SCP NIRB Condition 26	Are there any visual spills?				
NWB Part F Item 19	All Hazardous Waste disposal is located 30m from the ordinary high water mark.				
NWB Part H Item 3	Resources in place to prevent any chemicals, petroleum products, or unauthorized Wastes from entering a water body.				
NWB Part H Item 4 Ammonia Management Plan	Is secondary containment for chemical storage provided.				
NWB Part I Item 9	Monitoring signs are posted in English, French, and Inuktitut.				
MBK SCP	Spill Kits Present				
NIRB Condition 26	Ensure that spills, if any, are cleaned up immediately and that the site is kept clean of debris, including wind-blown debris.				
NIRB Condition 25	Management and control waste in a manner that reduces or eliminates the attraction to carnivores and/or raptors.				

# Agnico-Eagle Mines: Meadowbank Division

## Environment Department



NIRB Condition 27	Ensure the hazardous material are contained using environmentally protective methods based on practical best management practices				
Ammonia Management Plan	Are storage containers clearly labelled to identify Hazardous substance?				
Ammonia Management Plan	Are storage containers in good condition? Is there any visible damage or leaks? Can the doors be sealed shut?				
Ammonia Management Plan	Where necessary – Are containers with product stored in an upright position?				
Ammonia Management Plan	Do you see any potential environmental hazards posed by these HAZARDOUS containers/materials?				
BMP	Are there any additional environmental hazards/potential impacts that require attention?				
MINE ACT	Are there any Health and Safety issues that should be addressed to prevent injury to workers?				

### Pit Location:

### Blast Pattern#

In Compliance with	Subject	Conform	Non-conform	N/A	Comments
NWB Part D Item 29 MBK SCP NIRB Condition 26	Are there any visual spills, including emulsion?				
Ammonia Management Plan	Is there presence of Emulsion outside of the holes that are being loaded?				
NWB Part F Item 19	All Hazardous Waste disposal is located 30m from the ordinary high water mark.				

# Agnico-Eagle Mines: Meadowbank Division

## Environment Department



NWB Part H Item 3	Resources in place to prevent any chemicals, petroleum products, or unauthorized Wastes from entering a water body.				
NWB Part H Item 4 Ammonia Management Plan	Is secondary containment for chemical storage provided?				
NIRB Condition 27  Ammonia Management Plan	Ensure the hazardous material are contained using environmentally protective methods based on practical best management practices				

**Comments/Recommendations:**

**Environmental Personnel Name:**

**Signature:** \_\_\_\_\_

**Actions Corrected:**

---



---



---



---




---


**Site Service Supervisor Name:** \_\_\_\_\_

**Signature:** \_\_\_\_\_






**Picture 1:**



**Picture 2:**



**Picture 3:**