



MEADOWBANK COMPLEX

Monitoring Program Summary Report

June 2023

Type A Water License 2AM-MEA1530

Table of Contents

SECTION 1 • BACKGROUND..... 3

SECTION 2 • WATER MANAGEMENT 4

2.1 WATER USAGE4

2.2 WASTE ROCK STORAGE FACILITY SEEPAGE4

2.3 CENTRAL DIKE SEEPAGE4

2.4 ASSAY ROAD SEEPAGE4

2.5 SEEPAGE AND RUNOFF FROM THE LANDFILL5

2.6 SEWAGE TREATMENT PLANT5

2.7 VAULT ATTENUATION POND EFFLUENT6

2.8 PHASER ATTENUATION POND.....6

2.9 EAST DIKE SEEPAGE EFFLUENT.....6

2.10 NON-CONTACT WATER6

2.11 IN-PIT DISPOSAL6

SECTION 3 • SPILL MANAGEMENT 7

SECTION 1 • BACKGROUND

On May 13, 2020, Agnico Eagle received the minister's approval for the Water License 2AM-MEA1530 Amendment No.4. This amendment was required to authorize changes to the previously approved uses of water and deposit of wastes needed to reflect the expansion of the Whale Tail Mine.

As required under Part I, Item 21 of Type A Water License 2AM-MEA1530 (Amendment No.4), this report documents the water management and monitoring activities at the mine site for the month. This includes water usage, Vault Attenuation Pond and Phaser Attenuation Pond discharge and water quality, East Dike Seepage discharge water quality, RSF Seepage, Central Dike Seepage, Assay Road Seepage, sewage treatment plant discharge water quality (which is directed to the onsite storm water management pond) and an update to the In-Pit disposal.

In addition, a summary of spills/actions for the month is reported.

SECTION 2 • WATER MANAGEMENT

2.1 WATER USAGE

Fresh water usage for the month is summarized in Table 2.1 below.

Table 2.1: Freshwater Usage (m³)

Water Location	Source Lake	Jan	Feb	March	April	May	June	Total
Camp	Third Portage Lake	3,288	2,944	2,980	3,131	3,024	3,003	18,370
Mill (freshwater tank)	Third Portage Lake	50,174	55,874	62,407	60,918	48,147	85,133	362,653
Emulsion plant	Unnamed Lake	0	0	0	0	0	0	0
Total Freshwater Usage (m³)		53,462	58,818	65,387	64,049	51,171	88,136	381,023
Ore Water (m³)	Ore	5,853	5,146	5,195	4,478	2,510	5,418	28,600
Reclaim Water Usage (m³)	Tailings Pond	294,828	250,824	285,244	290,710	268,126	306,018	1,695,750

2.2 WASTE ROCK STORAGE FACILITY SEEPAGE

In June, a total of 29,845 m³ of water was pumped to Portage Pit from the ST-16 sump. Of that amount, 15,055 m³ was transferred from WEP1 sump and 10,177 m³ from WEP2 sump to the ST-16 sump.

Agnico Eagle completed inspections at the Portage and Vault RSFs, no non-conformities were found during the month.

2.3 CENTRAL DIKE SEEPAGE

In June, 112,689 m³ of water was pumped from ST-S-5 sump to Portage Pits.

Sampling was conducted minimally on a monthly basis at ST-S-5 as per the requirements of the NWB Water License.

Visual inspections are completed monthly, by the Environment Department, as well as daily monitoring of piezometric values.

2.4 ASSAY ROAD SEEPAGE

In June, 4,109 m³ of water was pumped from the mill trench back to the mill. As per the Freshet Action Plan, Agnico Eagle completed inspections and no non-conformities were found during the month.

2.5 SEEPAGE AND RUNOFF FROM THE LANDFILL

The landfill was inspected weekly, and no seepage or runoff was observed.

2.6 SEWAGE TREATMENT PLANT

One (1) effluent wastewater sample was collected at the onsite sewage treatment plant (STP) in June.

The Seprotech STP results are shown in Table 2.6.1 below; the LJ-Mix STP results are shown in Table 2.6.2. The effluent from the STP is discharged to the Stormwater Management pond.

In June, 41,724 m³ of water was pumped from the Stormwater Management pond to Portage Pits.

Table 2.6.1: Seprotech Effluent Results

Parameters	Units	June 6, 2023
Unionized Ammonia (NH ₃)	mg N/L	0.17
Ammonia-Nitrogen (NH ₃ -NH ₄)	mg N/L	43
Total Kjeldahl Nitrogen	mg N/L	41
BOD-5	mg/L	14
COD	mg/L	57
Total Suspended Solids	mg/L	17
Nitrate	mg N/L	4.58
Nitrite	mg N/L	1.18
pH*	Units	7.00
Fecal Coliform	UFC/100 mL	30
Total Coliform	UFC/100 mL	2,700

*Parameter measured by STP operators

Table 2.6.2: LJ-Mix Effluent Results

Parameters	Units	June 6, 2023
Unionized Ammonia (NH ₃)	mg N/L	0.054
Ammonia-Nitrogen (NH ₃ -NH ₄)	mg N/L	34
Total Kjeldahl Nitrogen	mg N/L	28
BOD-5	mg/L	23
COD	mg/L	54
Total Suspended Solids	mg/L	21
Nitrate	mg N/L	2.87
Nitrite	mg N/L	1.4
pH*	Units	6.60
Fecal Coliform	UFC/100 mL	500
Total Coliform	UFC/100 mL	12,000

*Parameter measured by STP operators

2.7 VAULT ATTENUATION POND EFFLUENT

No discharge has occurred from the Vault Attenuation Pond since October 9, 2017.

2.8 PHASER ATTENUATION POND

No water was pumped from the Phaser Attenuation Pond during the month.

No water was transferred from BB Phaser Pit sumps to the Phaser Attenuation Pond during the month.

2.9 EAST DIKE SEEPAGE EFFLUENT

No water was discharged from the East Dike to Second Portage Lake during the month. In June, water from the East Dike was discharged into Portage Pits.

2.10 NON-CONTACT WATER

In June, Agnico Eagle completed inspections at Portage Area East diversion ditch (ST-5) and West diversion ditch (ST-6) as part of the 2023 Freshet Management Plan. Portage Area East (ST-5) and West diversion ditches (ST-6) water quality results are shown in Tables 2.10.1 and 2.10.2, respectively.

TSS results for both stations did not exceed the maximum allowable grab sample concentration (30 mg/L) permitted by the Water License, Part F, Item 7. Both stations did not exceed the maximum average concentration (15 mg/L).

Table 2.10.1: Portage Area East Diversion Ditch (ST-5) Results

Parameters	Units	June 5, 2023
Total Suspended Solids (TSS)	mg/L	2

Table 2.10.2: Portage Area West Diversion Ditch (ST-6) Results

Parameters	Units	June 5, 2023
Total Suspended Solids (TSS)	mg/L	1

2.11 IN-PIT DISPOSAL

Tailings were disposed of in Portage Pits and reclaim water was taken from Portage Pits for the month.

SECTION 3 • SPILL MANAGEMENT

Figure 3.1 shows reported and non-reported spills for 2023 broken down per month and Table 3.1 summarizes Agnico Eagle spill reports for June.

Six (6) spills occurred on site during the month with four (4) being reported to regulators. Spills were contained and cleaned, contaminated material was disposed to the appropriate area, and the clean-up actions were monitored closely by the Environment Department.

Figure 3.1 2023 Reported and Non-Reported Spills

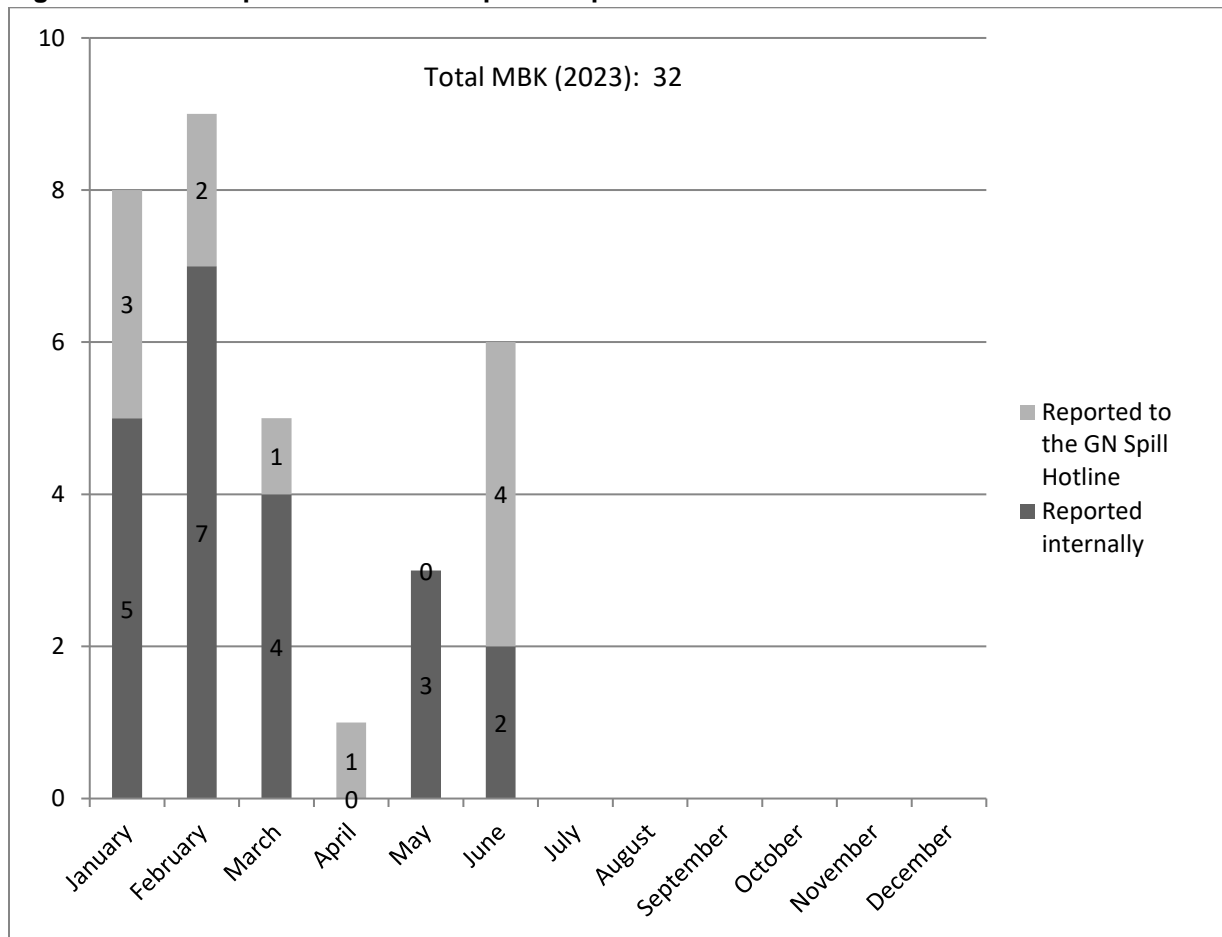


Table 3.1: Summary of Agnico Eagle Internal and Reported Spill Reports, June 2023

Date of Spill	Hazardous Material	Qty	Units (L / Kg)	Location	Cause of spill	Clean-up action taken
6/01/2023	Diesel Fuel	100	L	Meadowbank Fuel Farm	Human Error	Contaminated soil was collected and brought to a yellow bin for disposal at the Meadowbank Landfarm.
6/03/2023	TSS	N/A	KG	Baker Lake Spud Barge	Surface water runoff during Freshet through exposed till. Cause	Turbidity booms, curtains and excavation to control additional runoff from entering the lake.
6/03/2023	Waste Oil	1,500	L	Warehouse Laydown	Improper storage	Contaminated soil was collected and brought to a yellow bin for disposal at the Meadowbank Landfarm. Contaminated water on the surface was collected and disposed at the Stormwater Management pond.
6/05/2023	Hydraulic Oil	10	L	Winter Parking	Human Error	Contaminated soil was collected and brought to a yellow bin for disposal at the Meadowbank Landfarm.
6/11/2023	Diesel Fuel	10	L	Meadowbank Fuel Farm	Mechanical Failure	Contaminated soil was collected and brought to a yellow bin for disposal at the Meadowbank Landfarm
6/20/2023	Diesel Fuel	150	L	Winter Parking	Mechanical Failure	Contaminated soil was collected and brought to a yellow bin for disposal at the Meadowbank Landfarm

3.1 KM87 SPILL FOLLOW UP

In June, Agnico Eagle completed inspections at KM87 spill areas as part of the 2023 Freshet Management Plan. A total of 5,378 m³ was pumped from the collection sump and brought to the Stormwater management pond. Sampling was collected downstream of the collection sump at sampling station ST-44. Water quality results are shown in table 3.2.

Table 3.2: KM87 (ST-44) Results

Parameter	Unit	6/21/2023	6/25/2023
pH	pH units	6.64	7.12
TSS	mg/L	1	1
Total oil and grease	mg/L	< 0.50	1.2
Benzene	mg/L	< 0.00020	< 0.00020
Ethylbenzene	mg/L	< 0.00020	< 0.00020
Toluene	mg/L	< 0.00020	< 0.00020
Xylenes	mg/L	0.00046	< 0.00040
m,p-Xylenes	mg/L	< 0.00040	< 0.00040
o-Xylene	mg/L	0.00046	< 0.00020
F2 (C10-C16)	mg/L	< 0.1	< 0.1
F3 (C16-C34)	mg/L	< 0.2	< 0.2
F4 (C34-C50)	mg/L	< 0.2	< 0.2
Petroleum Hydrocarbons F (C10-C50)	mg/L	< 0.2	< 0.2